

## General Information

Date & Time: 26, Feb, 2026 15:14

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	91,423
<b>Registration No.</b>	CBT5958	<b>Chassis No.</b>	PA1B18F30P4203550
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



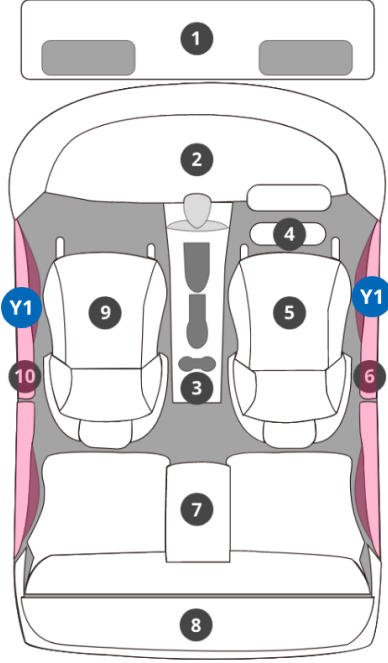
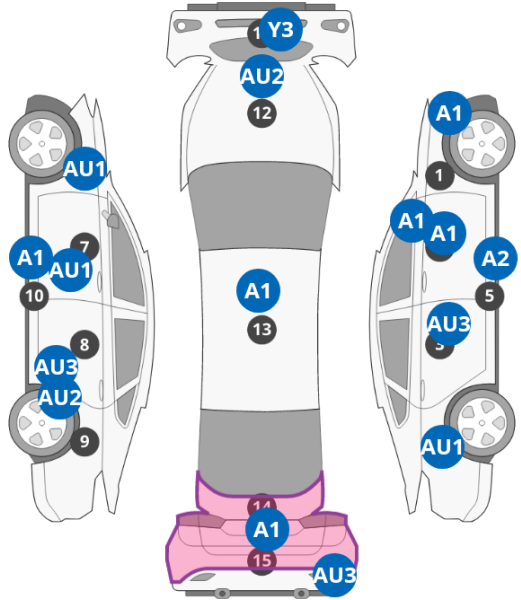
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	115	106	118
2	Boot Lid	130.3	105	172	114
3	Roof	100.4	102	96	106/98
4	Left Front Fender	100.0	100	100	100
5	Left Front Door	97.8	100	96	97
6	Center Panel Left				
7	Left Rear Door	102.6	106	96	106
8	Left Back Panel	108.6	113	105	108
9	Right Front Fender	104.0	103	109	100
10	Right Front Door	98.3	98	94	103
11	Center Panel Right				
12	Right Rear Door	106.0	103	106	109
13	Right Back Panel	107.3	105	106	111

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>No Lto plate, with warranty booklet, with spare tire and jack, 3keys, no tools, scratches on headlights and taillights, battery weak</p>