

## General Information

Date & Time: 26, Feb, 2026 14:25

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	39,710
<b>Registration No.</b>	KAT1268	<b>Chassis No.</b>	PA1B18F30P4231946
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



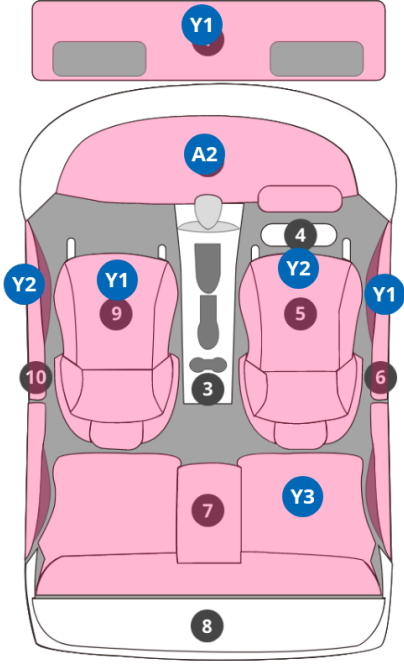
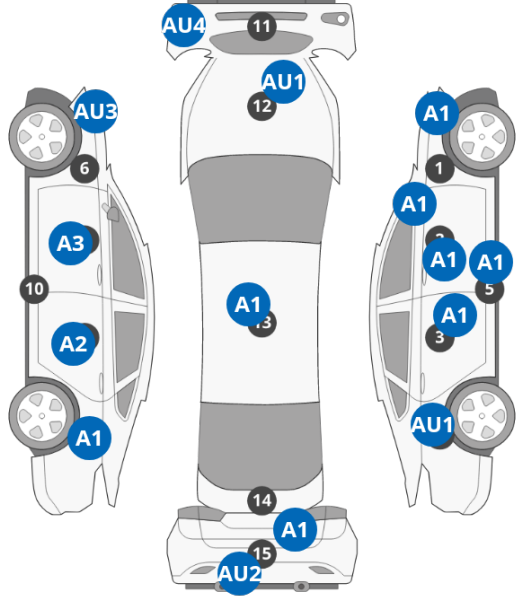
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	119	104	109
2	Boot Lid	114.3	112	111	120
3	Roof	93.7	96	97	87/95
4	Left Front Fender	96.8	93	101	97
5	Left Front Door	97.2	99	95	97
6	Center Panel Left				
7	Left Rear Door	101.8	100	100	106
8	Left Back Panel	109.6	117	105	107
9	Right Front Fender	105.0	105	107	103
10	Right Front Door	98.2	97	98	100
11	Center Panel Right				
12	Right Rear Door	100.2	100	99	102
13	Right Back Panel	102.0	100	102	104

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch &amp; Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with warranty booklet, 1key, no spare tire, no jack and tools, scratches on headlights and taillights</p>