

General Information

Date & Time: 26, Feb, 2026 12:12

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	49,692
Registration No.	NIS4283	Chassis No.	JTNAFAP58035704
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



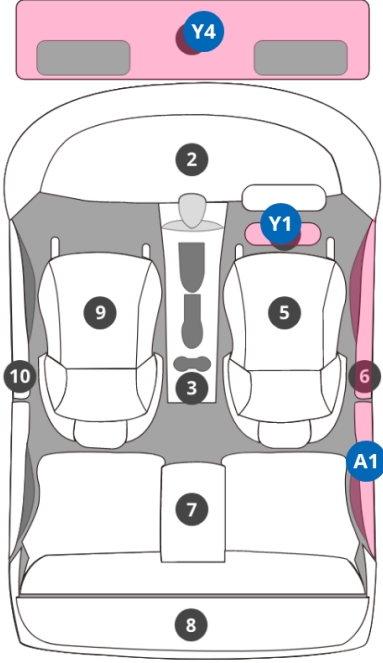
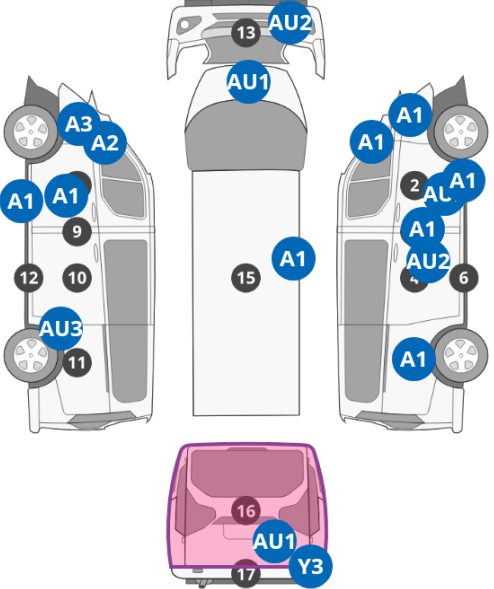
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	118	125	105
2	Boot Lid	342.3	143	567	317
3	Roof	124.0	125	113	137/121
4	Left Front Fender	100.8	96	104	103
5	Left Front Door	104.1	111	102	99
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	101.5	103	99	103
9	Right Front Fender	102.7	111	101	96
10	Right Front Door	105.0	101	102	112
11	Center Panel Right	117.0	119	122	110
12	Right Rear Door	107.0	105	102	114
13	Right Back Panel	104.6	109	98	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trim Other - Cut, Crack - Minimal / (R) Front Floor Mat - Grime - Minimal / Ceiling - Grime - Large</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights, Crack taillight</p>