

## General Information

Date & Time: 26, Feb, 2026 12:19

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	46,567
<b>Registration No.</b>	NHS8987	<b>Chassis No.</b>	PA1B18F37R4270357
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



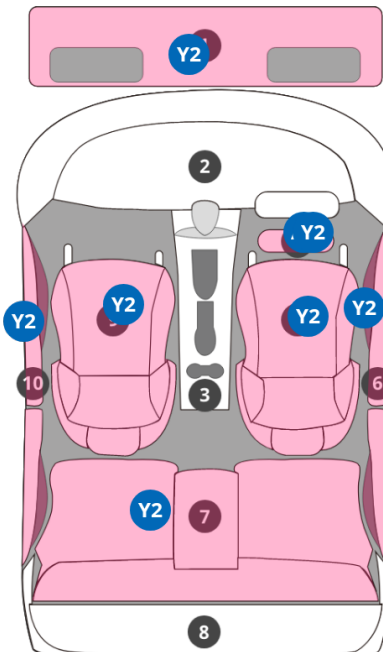
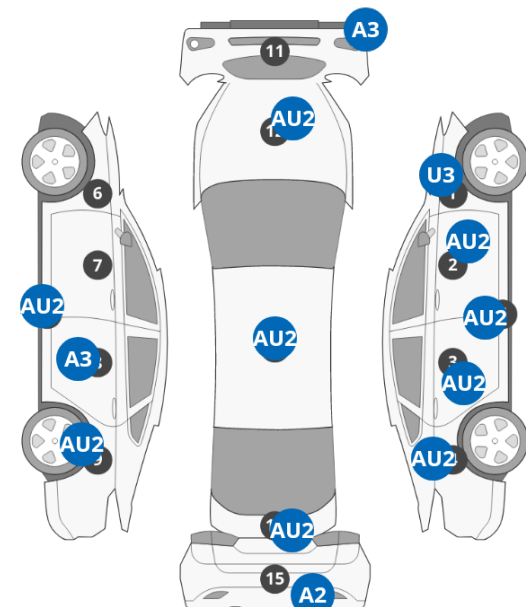
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>114.6</b>	117	104	123
2	Boot Lid	<b>117.3</b>	125	100	127
3	Roof	<b>102.1</b>	114	95	97/102
4	Left Front Fender	<b>131.3</b>	138	130	126
5	Left Front Door	<b>400.3</b>	892	149	160
6	Center Panel Left				
7	Left Rear Door	<b>119.0</b>	114	131	112
8	Left Back Panel	<b>115.3</b>	126	111	109
9	Right Front Fender	<b>111.0</b>	114	111	108
10	Right Front Door	<b>112.0</b>	116	116	104
11	Center Panel Right				
12	Right Rear Door	<b>108.0</b>	106	106	112
13	Right Back Panel	<b>106.6</b>	106	100	114

**Overall Evaluation :**

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Small</p>	<p><b>Remarks</b>  (L) Front Door - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Dent - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare key, with jack and inc tools, with manual and warranty booklet, no spare tire, scratches on taillight and headlight.</p>