

## General Information

Date & Time: 02, Mar, 2026 12:25

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	16,026
<b>Registration No.</b>	NGC9383	<b>Chassis No.</b>	MHKAA1BC6RJ025495
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



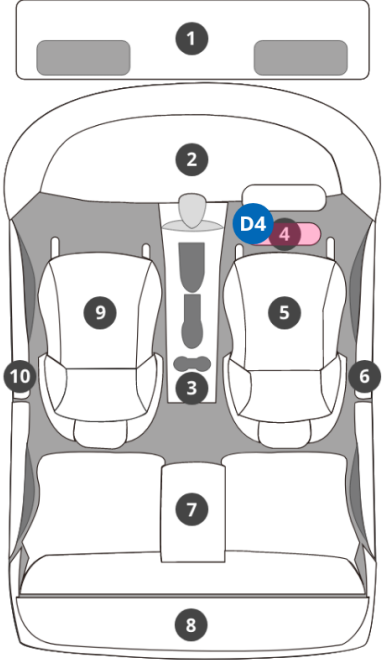
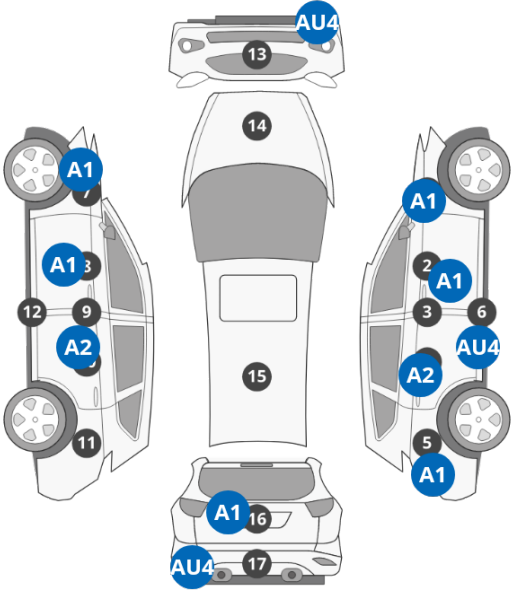
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	109	106	109
2	Boot Lid	82.9	82	86	81
3	Roof	84.9	105	92	74/70
4	Left Front Fender	83.5	73	91	86
5	Left Front Door	112.1	97	120	119
6	Center Panel Left				
7	Left Rear Door	102.8	113	104	92
8	Left Back Panel	90.3	94	85	92
9	Right Front Fender	90.8	89	106	78
10	Right Front Door	108.3	114	109	102
11	Center Panel Right				
12	Right Rear Door	105.0	97	105	113
13	Right Back Panel	96.2	101	94	94

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Floor Mat - Worked - Large	<b>Remarks</b> Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Spare Key - Issue - Unexist

<b>Inspector Notes</b>
no tools/ abnormal engine noise/ with LTO plate and warranty booklet/ with spare tire and jack /