

General Information

Date & Time: 02, Mar, 2026 15:58

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	161,263
Registration No.	NHC5236	Chassis No.	PA1B18F34N4197443
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



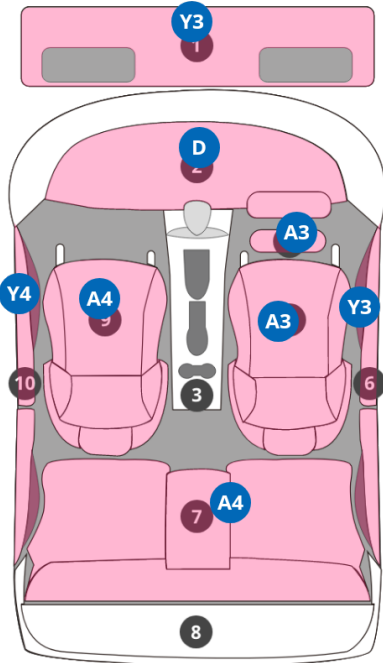
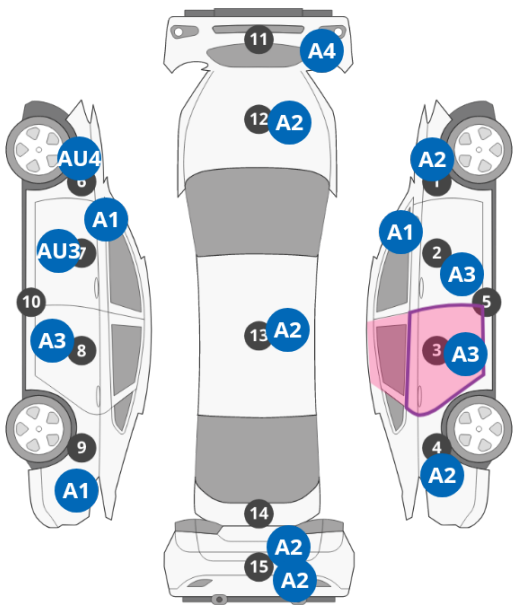
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	118	106	113
2	Boot Lid	103.9	106	100	106
3	Roof	101.3	96	101	90/118
4	Left Front Fender	94.8	92	94	98
5	Left Front Door	104.3	101	103	109
6	Center Panel Left				
7	Left Rear Door	106.3	108	103	108
8	Left Back Panel	107.3	120	101	101
9	Right Front Fender	117.3	122	115	115
10	Right Front Door	79.8	82	76	82
11	Center Panel Right				
12	Right Rear Door	139.0	102	142	173
13	Right Back Panel	99.7	98	98	103

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Cut, Crack - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Cut, Crack - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Medium</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 2 spare key/No seat cover/No reverse camera/plate light issue/with jack and incomplete tools/with warranty booklet/interior dirty/front left panel switch issue</p>