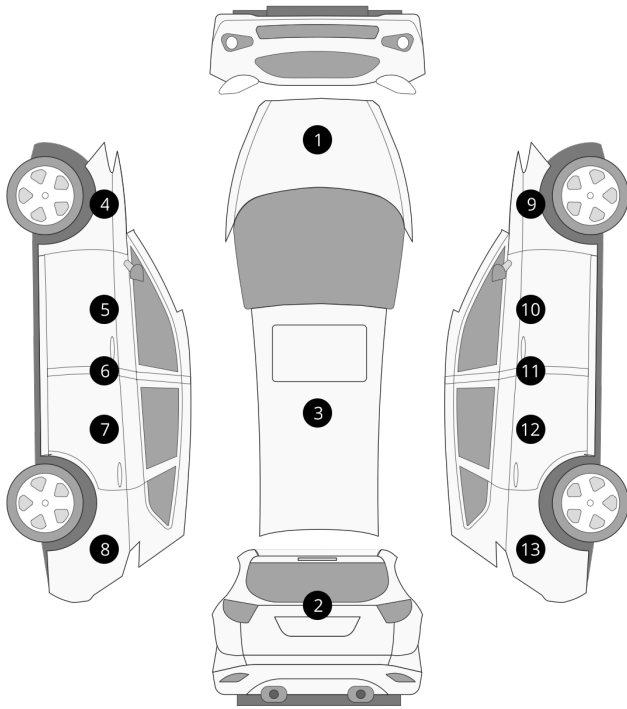


## General Information

Date & Time: 04, Mar, 2026 09:41

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	29,823
<b>Registration No.</b>	NHJ8540	<b>Chassis No.</b>	PA1B18F30R4218825
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



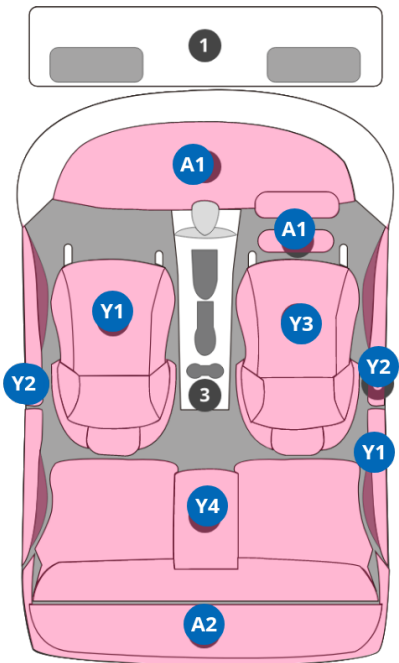
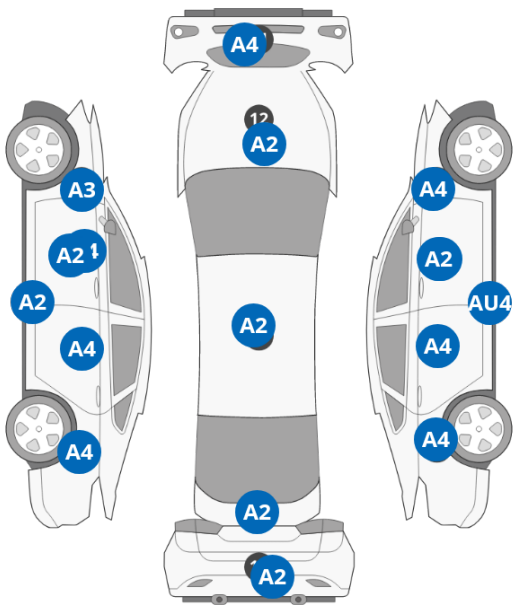
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	105	104	116
2	Boot Lid	107.3	100	110	112
3	Roof	99.2	105	89	105/98
4	Left Front Fender	98.7	96	98	102
5	Left Front Door	100.6	101	95	106
6	Center Panel Left				
7	Left Rear Door	98.9	110	93	94
8	Left Back Panel	103.7	115	97	100
9	Right Front Fender	113.6	100	121	120
10	Right Front Door	94.0	97	90	95
11	Center Panel Right				
12	Right Rear Door	98.6	101	95	100
13	Right Back Panel	112.7	98	119	121

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / Carpet - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal	<b>Remarks</b> (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Fender, Molding - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Reverse Camera - N/A - Yes

<b>Inspector Notes</b>
With LTO plate/with warranty booklet/no spare tire/with tools and jack/with spare key/no reverse camera/no seat cover