

General Information

Date & Time: 02, Mar, 2026 09:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	67,537
Registration No.	NIN8106	Chassis No.	PA1B18F30P4210465
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



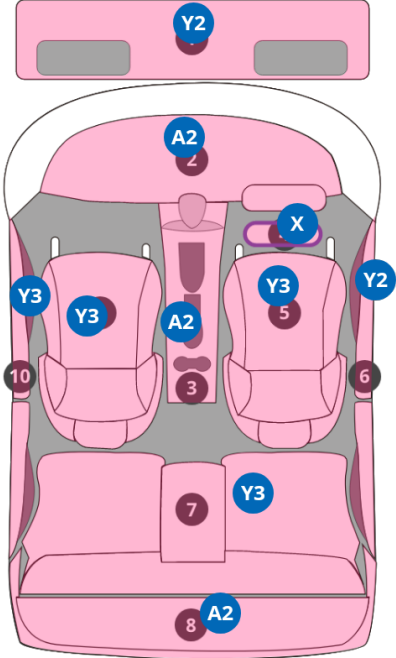
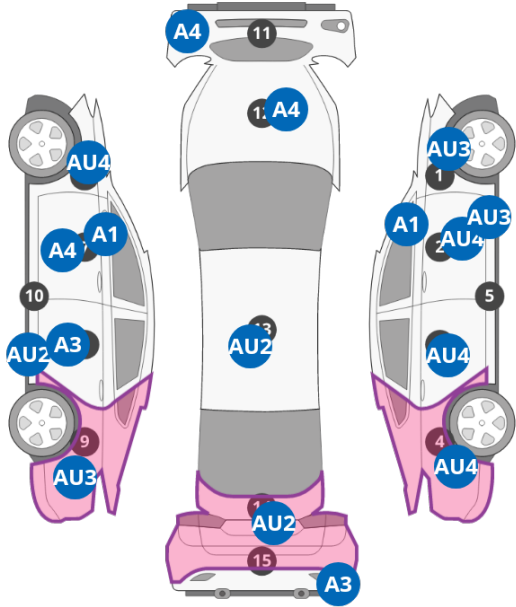
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	104	100	110
2	Boot Lid	94.2	96	96	90
3	Roof	91.4	98	94	81/92
4	Left Front Fender	93.0	96	90	93
5	Left Front Door	95.5	100	92	95
6	Center Panel Left				
7	Left Rear Door	91.8	96	95	85
8	Left Back Panel	172.0	170	169	177
9	Right Front Fender	100.6	105	96	101
10	Right Front Door	99.1	91	99	108
11	Center Panel Right				
12	Right Rear Door	153.6	176	148	137
13	Right Back Panel	444.6	238	757	339

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Missing - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/park light issue/plate light issue/with jack and incomplete tools/with warranty booklet/drive side floor mats missing/trunk hood traces of repair/</p>