

## General Information

Date & Time: 03, Mar, 2026 10:19

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	35,036
<b>Registration No.</b>	NKJ8825	<b>Chassis No.</b>	PA1B18F34R4267688
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



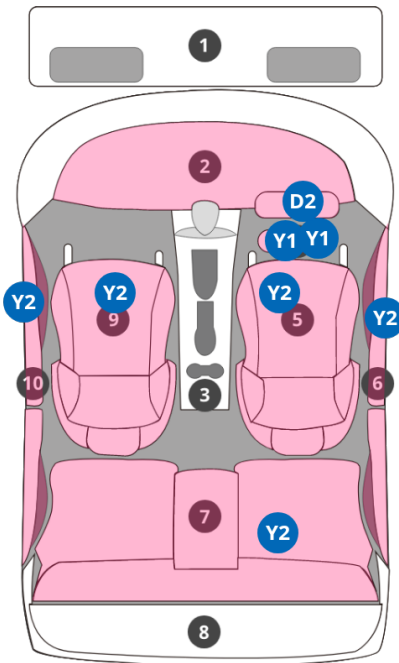
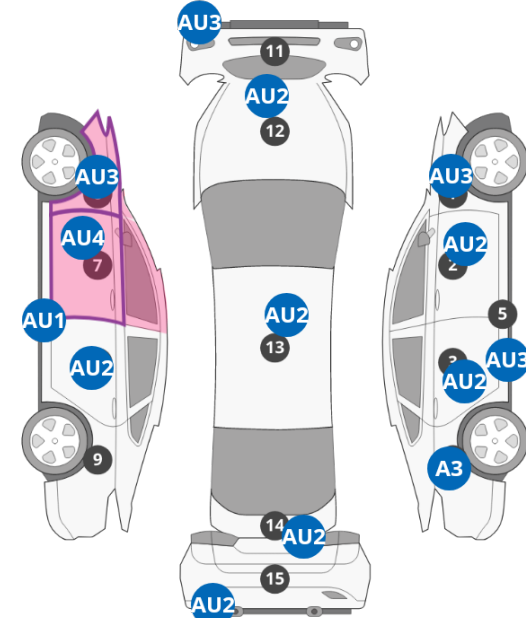
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	111	117	106
2	Boot Lid	121.6	119	114	132
3	Roof	107.2	105	120	94/110
4	Left Front Fender	291.6	401	373	101
5	Left Front Door	107.6	104	110	109
6	Center Panel Left				
7	Left Rear Door	108.6	114	105	107
8	Left Back Panel	116.6	117	122	111
9	Right Front Fender	106.6	107	104	109
10	Right Front Door	109.3	114	111	103
11	Center Panel Right				
12	Right Rear Door	127.3	142	131	109
13	Right Back Panel	107.9	100	104	120

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / Glove Box - Loose, Deformed - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>	
<p>with LTO plate, with reverse camera, spare key, no warranty and manual booklet, no spare tire, scratches on taillight and headlight,</p>	