

General Information

Date & Time: 27, Feb, 2026 14:21

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	102,659
Registration No.	NCS8950	Chassis No.	PAFA131JJA0M196
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



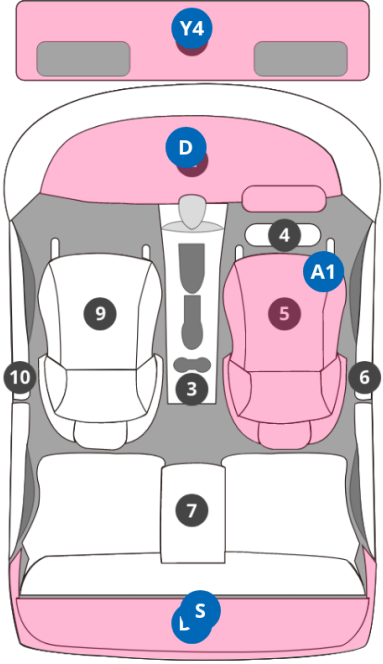
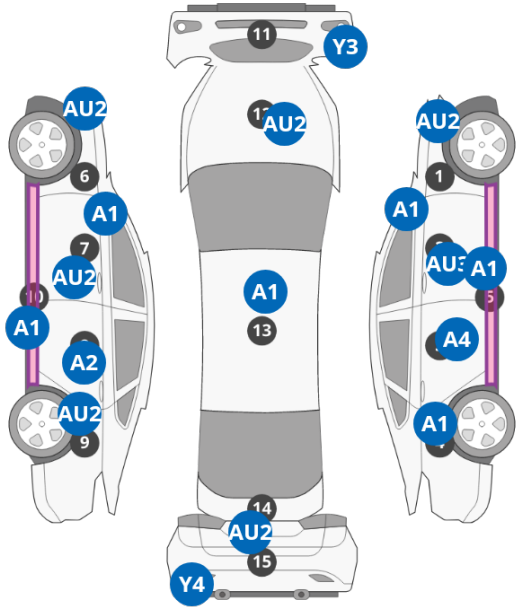
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	197.6	214	181	198
2	Boot Lid	189.6	184	206	179
3	Roof	92.5	93	92	95/92
4	Left Front Fender	213.6	206	207	228
5	Left Front Door	227.3	213	193	276
6	Center Panel Left				
7	Left Rear Door	233.6	255	238	208
8	Left Back Panel	931.0	321	1,269	1,203
9	Right Front Fender	561.0	361	985	337
10	Right Front Door	236.6	230	235	245
11	Center Panel Right				
12	Right Rear Door	200.6	232	169	201
13	Right Back Panel	517.6	1,045	261	247

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
<div style="text-align: center;">  </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Cut, Crack - Minimal / Trunk Room - Loose, Deformed - Large / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, 1key, no spare tire, no jack and tools, scratches on headlights and taillights, trunk cover missing, foul smell, possible flooding, bumper hook cover missing</p>