

General Information

Date & Time: 05, Feb, 2025 15:38

Make	Toyota	Model	Vios
YOM	2023	Mileage	54,705
Registration No.	NHF2251	Chassis No.	PA1B18F39P4216877
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



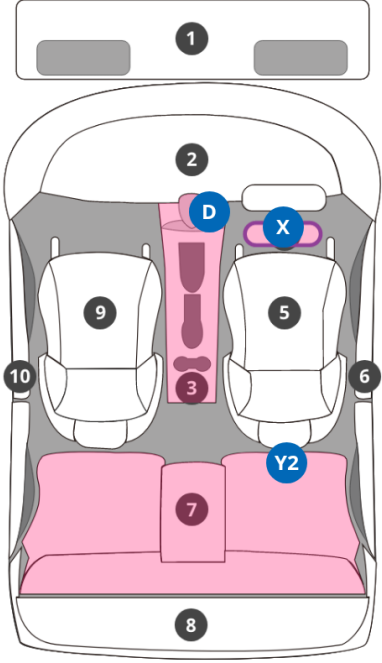
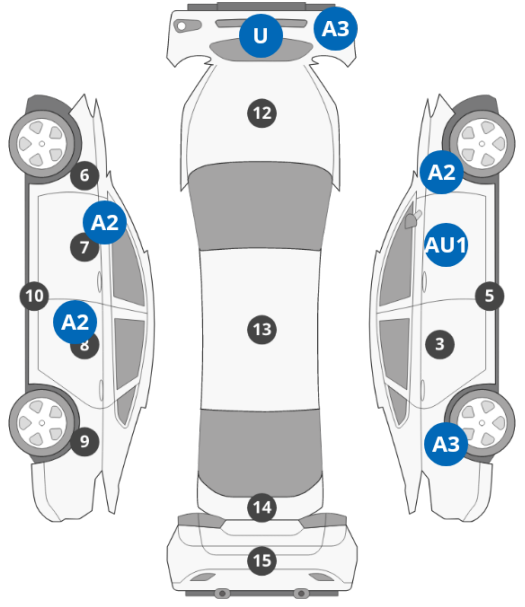
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	104	107	104
2	Boot Lid	109.0	102	110	115
3	Roof	103.6	108	95	103/109
4	Left Front Fender	97.8	99	100	95
5	Left Front Door	91.1	89	91	94
6	Center Panel Left				
7	Left Rear Door	108.6	118	103	105
8	Left Back Panel	102.7	106	104	98
9	Right Front Fender	89.8	88	89	93
10	Right Front Door	93.5	97	92	92
11	Center Panel Right				
12	Right Rear Door	102.0	94	97	115
13	Right Back Panel	99.2	101	98	99

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switches, Vents - Traces of Adhesive Tape - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes

Inspector Notes
no spare tire, tools, jack and warranty booklet. with LTO plate. adhesive marks at all door panels. engine bay cover missing.