

## General Information

Date & Time: 27, Feb, 2026 14:24

<b>Make</b>	Honda	<b>Model</b>	City
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	66,111
<b>Registration No.</b>	NDM3937	<b>Chassis No.</b>	PADGM6620LV618598
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



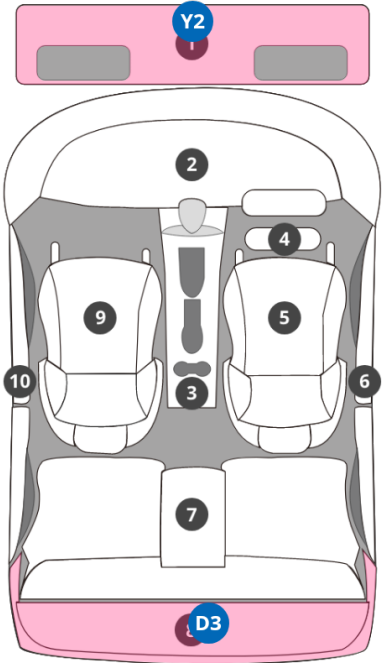
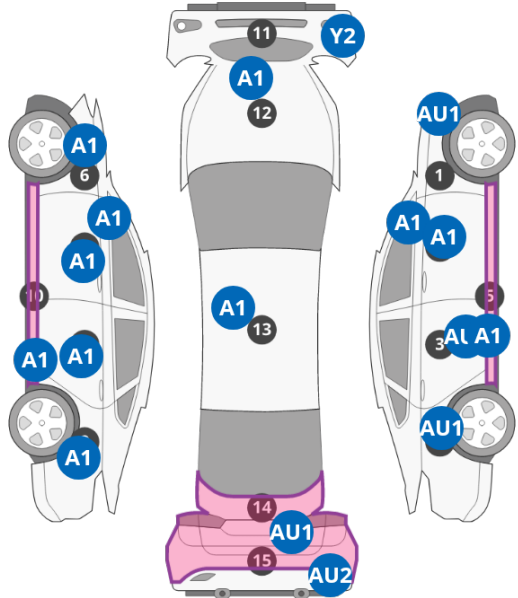
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.3	129	131	125
2	Boot Lid	506.0	839	353	326
3	Roof	86.3	84	89	75/98
4	Left Front Fender	135.3	136	137	133
5	Left Front Door	137.6	134	116	163
6	Center Panel Left				
7	Left Rear Door	151.3	187	118	149
8	Left Back Panel	149.3	174	139	135
9	Right Front Fender	199.3	149	131	318
10	Right Front Door	123.6	135	102	134
11	Center Panel Right				
12	Right Rear Door	142.6	143	136	149
13	Right Back Panel	147.0	135	132	174

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small / Trunk Room - Loose, Deformed - Medium	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Power Window (each) - Stuck, Gap - Yes

<b>Inspector Notes</b>
With Lto plate, with warranty booklet, with spare tire and jack, 2keys, no tools,scratches on headlights and taillights, cover under trunk missing,