

General Information

Date & Time: 02, Mar, 2026 13:43

Make	Ford	Model	Ranger
YOM	2017	Odo Meter Reading	94,891
Registration No.	NBC1779	Chassis No.	MNCUMFF50HW737304
CC	3.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



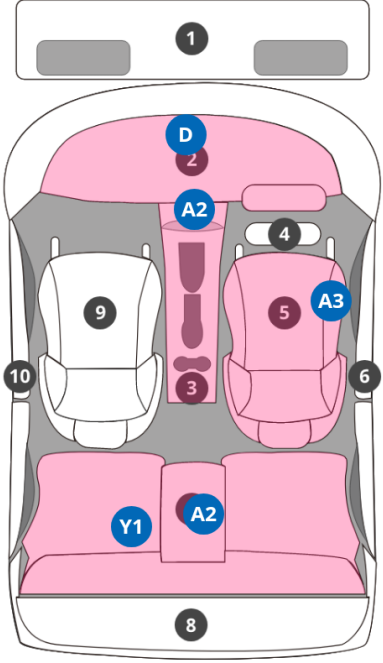
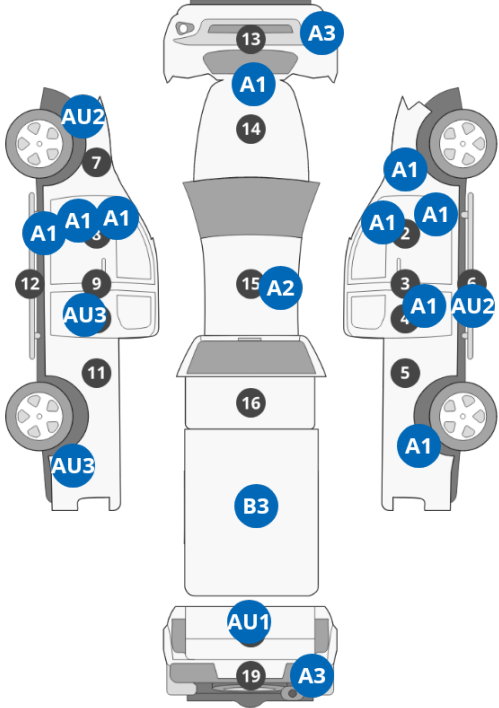
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	346.0	328	535	175
2	Boot Lid	124.6	121	141	112
3	Roof	172.0	157	174	188/169
4	Left Front Fender	172.3	195	145	177
5	Left Front Door	344.6	177	158	699
6	Center Panel Left				
7	Left Rear Door	254.6	264	340	160
8	Left Back Panel	234.0	313	231	158
9	Right Front Fender	152.6	154	145	159
10	Right Front Door	177.3	203	172	157
11	Center Panel Right				
12	Right Rear Door	289.0	217	302	348
13	Right Back Panel	176.3	188	185	156

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Cut, Crack - Medium / Knobs - Worn, Peel, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal / Seat belt Other - Cut, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Minimal / Cab Back Panel - Modified - Medium / Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, 1key, no jack and tools, scratches on headlights and taillights, battery weak,</p>