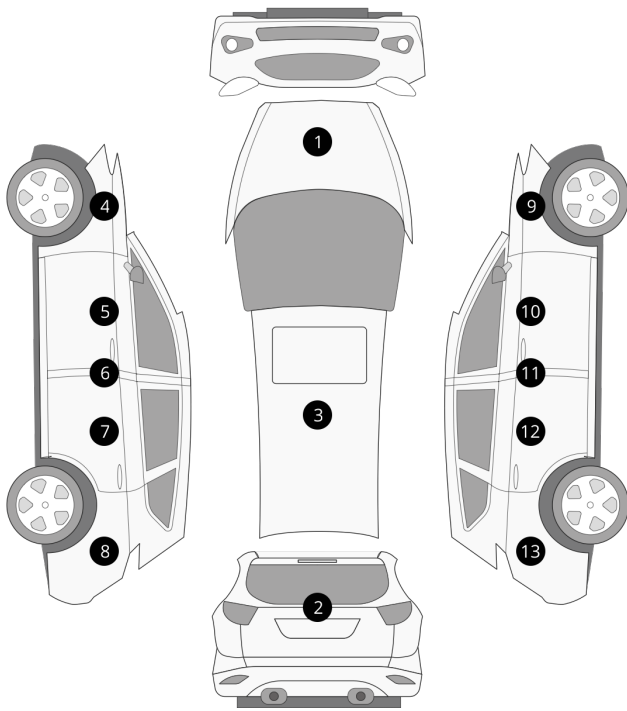


## General Information

Date & Time: 04, Mar, 2026 14:28

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	18,040
<b>Registration No.</b>	NFC5024	<b>Chassis No.</b>	MR0JB8DD2P3550708
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Black		

## Body / Panel Condition



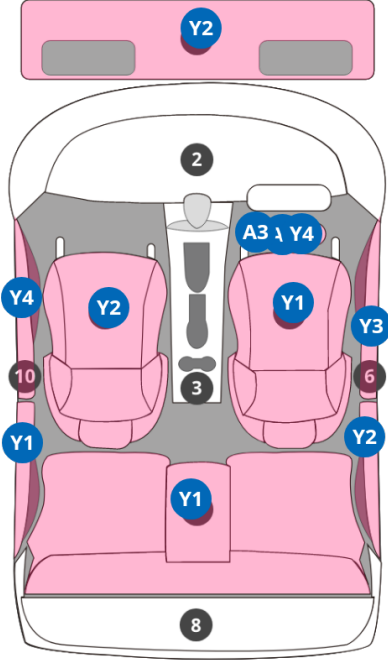
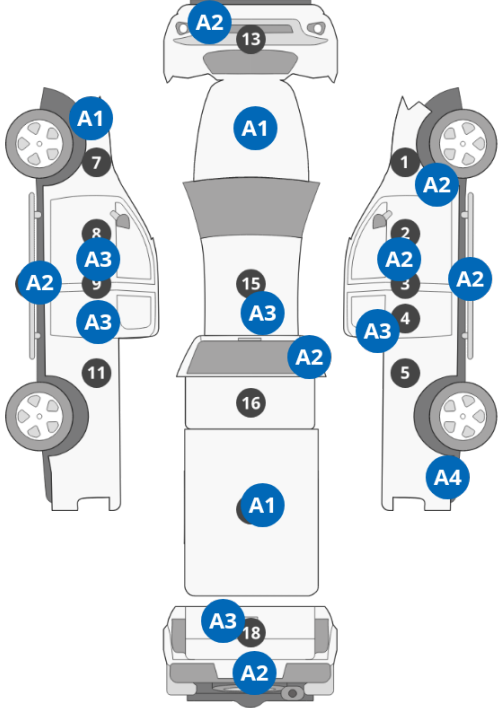
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	119	116	117
2	Boot Lid	106.9	113	94	114
3	Roof	123.2	113	133	130/117
4	Left Front Fender	109.0	110	110	107
5	Left Front Door	107.8	98	112	113
6	Center Panel Left	99.3	86	115	97
7	Left Rear Door	111.6	105	119	111
8	Left Back Panel	125.6	131	126	120
9	Right Front Fender	110.0	115	106	109
10	Right Front Door	104.6	112	102	100
11	Center Panel Right	92.9	92	93	95
12	Right Rear Door	102.1	99	100	108
13	Right Back Panel	109.7	113	120	96

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Minimal / Carpet - Worn, Scratch, Cut, Crack - Small / (R) Front Floor Mat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Large / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (R) Guard Frame - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Cargo Bed Floor - Scratch - Minimal / Roof - Scratch - Medium / Cab Back Panel - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate/with warranty booklet/no tools and jack/with spare tire/</p>