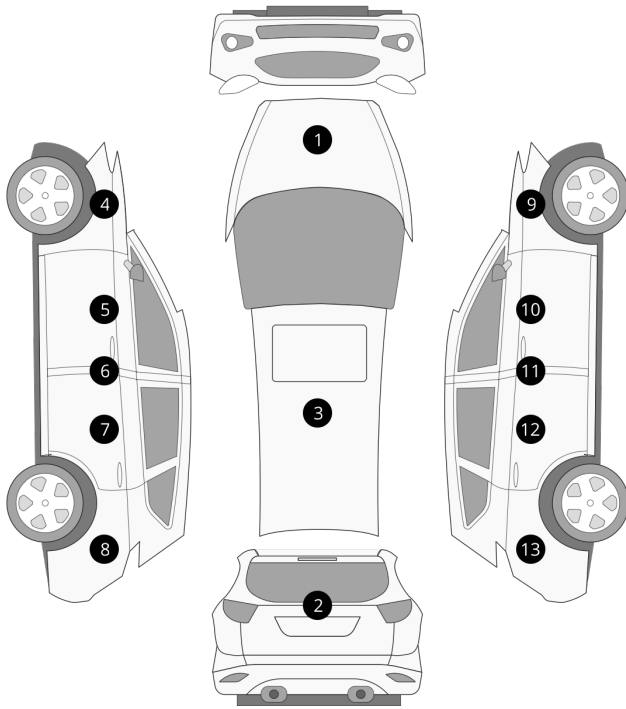


General Information

Date & Time: 03, Mar, 2026 14:53

Make	Toyota	Model	Corolla Altis
YOM	2023	Odo Meter Reading	43,542
Registration No.	NIF3610	Chassis No.	MR2BB3BE2N2003211
CC	1.6	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



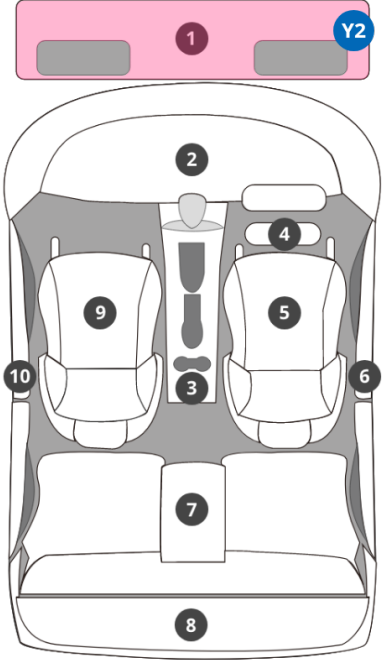
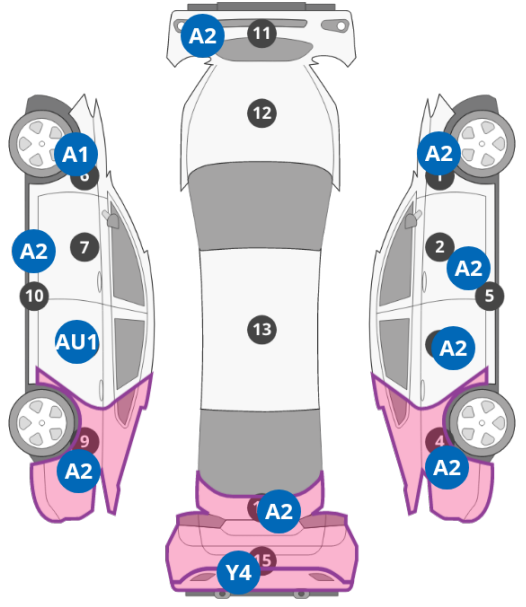
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.6	133	130	126
2	Boot Lid	163.3	155	139	196
3	Roof	138.7	126	148	144/137
4	Left Front Fender	119.6	122	134	103
5	Left Front Door	113.6	109	113	119
6	Center Panel Left				
7	Left Rear Door	114.6	122	115	107
8	Left Back Panel	197.3	191	197	204
9	Right Front Fender	128.3	119	133	133
10	Right Front Door	111.0	113	109	111
11	Center Panel Right				
12	Right Rear Door	110.3	107	112	112
13	Right Back Panel	180.6	182	188	172

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes	
with warranty booklet and LTO plate/ with jack and spare tire/ with tools	