

## General Information

Date & Time: 03, Mar, 2026 15:46

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	18,425
<b>Registration No.</b>	NJA4250	<b>Chassis No.</b>	MHFAA1BY6R0037372
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Silver		

## Body / Panel Condition



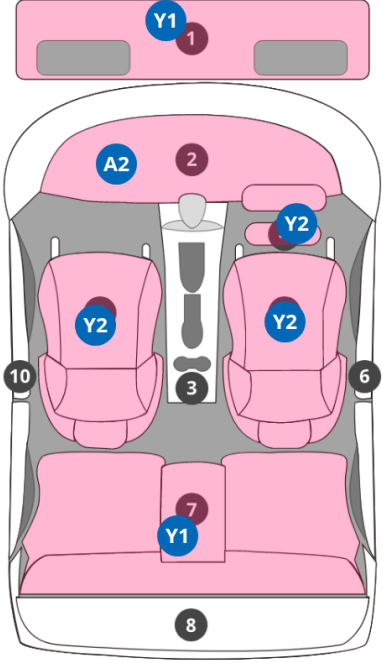
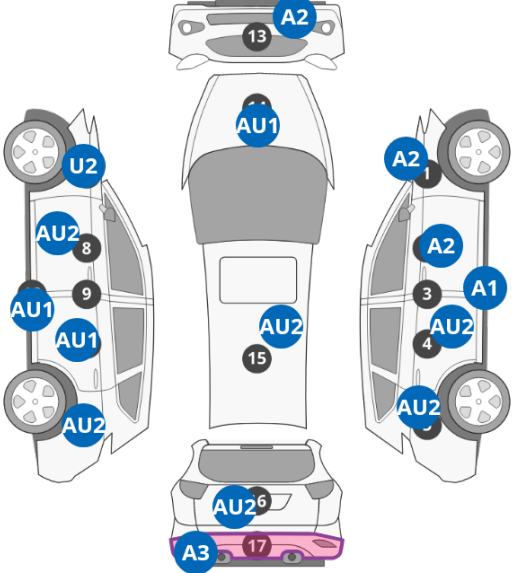
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	113	110	103
2	Boot Lid	109.3	106	102	120
3	Roof	123.0	123	134	106/129
4	Left Front Fender	106.6	104	113	103
5	Left Front Door	119.6	110	123	126
6	Center Panel Left				
7	Left Rear Door	120.0	119	113	128
8	Left Back Panel	123.0	137	115	117
9	Right Front Fender	104.5	112	108	94
10	Right Front Door	118.6	123	117	116
11	Center Panel Right				
12	Right Rear Door	123.3	126	125	119
13	Right Back Panel	113.0	122	102	115

**Overall Evaluation :**

B

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Roof - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare key, with jack, with spare tire, with reverse camera, with manual and warranty booklet, scratches on taillight and headlight.</p>