

General Information

Date & Time: 02, Mar, 2026 14:45

Make	Suzuki	Model	Alto
YOM	2016	Odo Meter Reading	84,209
Registration No.	NDV4412	Chassis No.	MA3FB32S9G0783816
CC	0.8	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



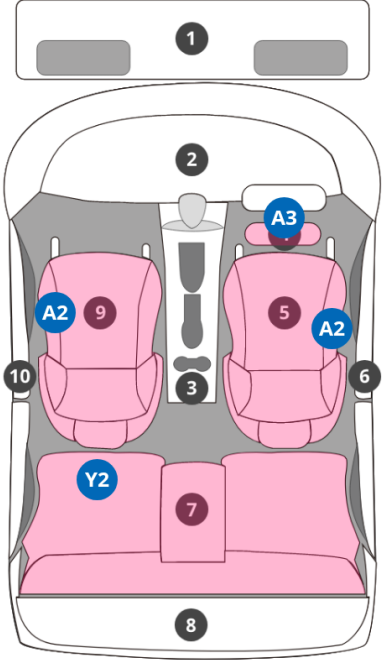
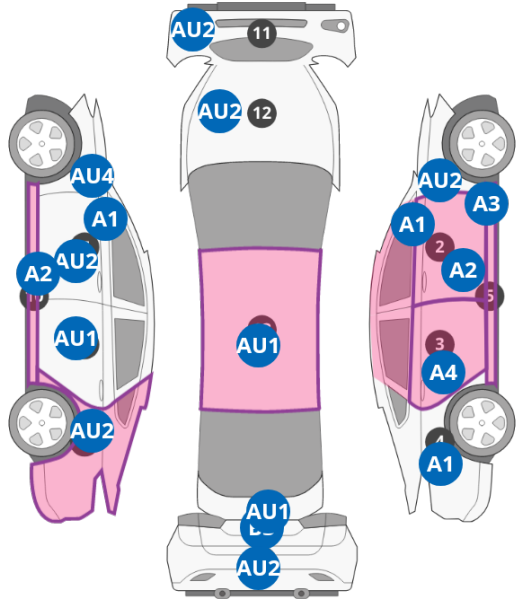
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.8	90	77	76
2	Boot Lid	197.3	209	188	195
3	Roof	229.5	176	194	252/296
4	Left Front Fender	324.3	292	355	326
5	Left Front Door	872.6	963	734	921
6	Center Panel Left				
7	Left Rear Door	275.6	373	256	198
8	Left Back Panel	338.6	392	293	331
9	Right Front Fender	196.0	228	181	179
10	Right Front Door	258.0	347	202	225
11	Center Panel Right				
12	Right Rear Door	284.6	296	262	296
13	Right Back Panel	189.3	187	184	197

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (L) Front Seat - Cut, Crack - Small / (R) Front Seat - Cut, Crack - Small / Carpet - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Modified - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Repair mark - Yes / Roof - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes</p>

Inspector Notes

With Lto plate, with spare tire, 2 keys, no jack and tools, no warranty booklet, Issue Right rear door, front wiper cowling cover missing, trunk door issue, faded headlights, cover under hood missing,