

General Information

Date & Time: 03, Mar, 2026 16:26

Make	Toyota	Model	Fortuner
YOM	2022	Odo Meter Reading	120,738
Registration No.	FAJ5972	Chassis No.	MHFAA8GS6N0778446
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



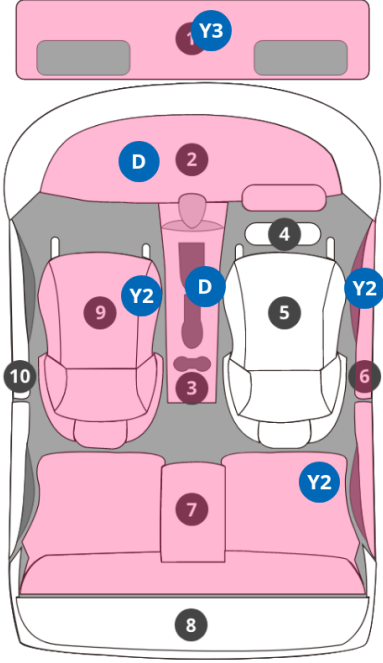
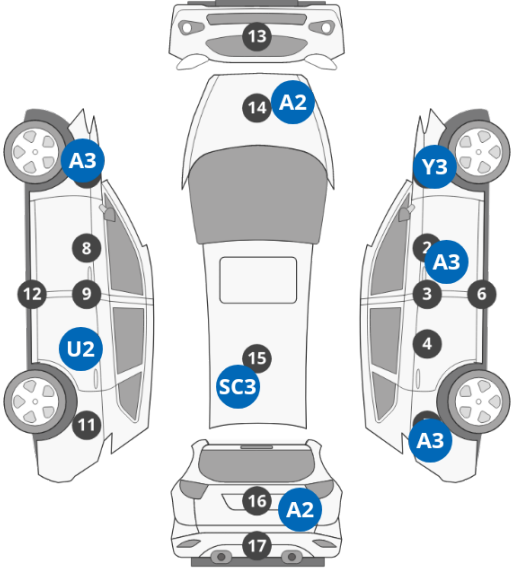
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	180.6	191	195	156
2	Boot Lid	135.6	117	154	136
3	Roof	99.8	98	115	90/97
4	Left Front Fender	144.6	136	141	157
5	Left Front Door	131.0	127	120	146
6	Center Panel Left				
7	Left Rear Door	147.0	149	116	176
8	Left Back Panel	172.6	176	149	193
9	Right Front Fender	154.0	162	148	152
10	Right Front Door	154.3	164	140	159
11	Center Panel Right				
12	Right Rear Door	165.0	152	167	176
13	Right Back Panel	175.6	166	182	179

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / Console, Switchs, Vents - Repair Mark - Yes / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Roof - Rust, Corrosion - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Fender, Molding - Crack, Gap - Medium</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Power Seat not functioning. With Spare Tire. With Spare Key. Rust on front seat railing (possible flooded). Check engine. No seat cover. with jack and tools</p>