

General Information

Date & Time: 03, Mar, 2026 16:24

Make	Toyota	Model	Avanza
YOM	2022	Odo Meter Reading	77,087
Registration No.	FAN6971	Chassis No.	MHFAA1BY4N0005885
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



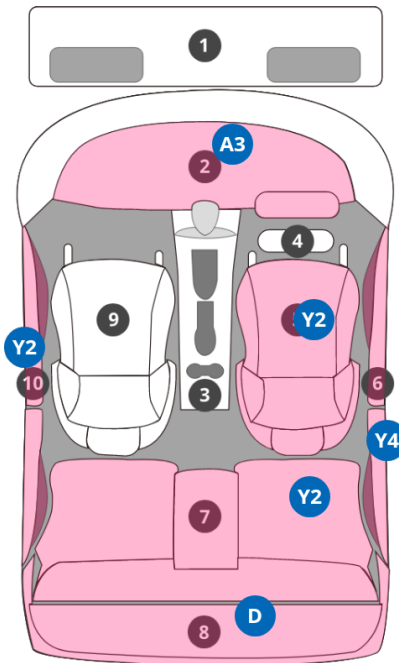
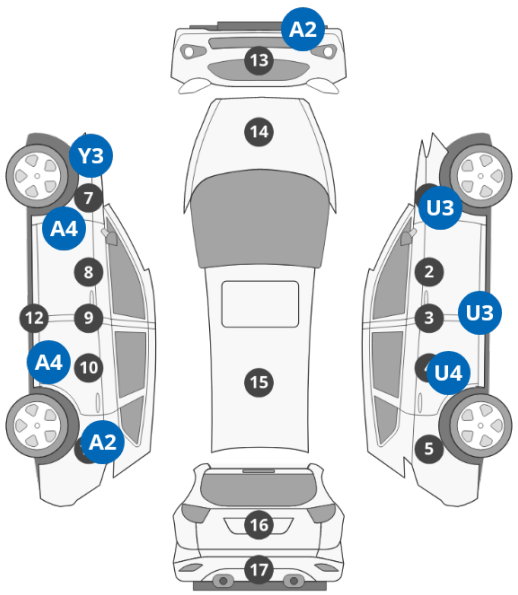
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.0	98	93	95
2	Boot Lid	105.4	89	114	113
3	Roof	96.2	95	108	92/90
4	Left Front Fender	327.3	460	189	333
5	Left Front Door	442.3	938	179	210
6	Center Panel Left				
7	Left Rear Door	749.3	1,144	241	863
8	Left Back Panel	298.6	591	138	167
9	Right Front Fender	90.2	89	94	88
10	Right Front Door	99.7	98	98	103
11	Center Panel Right				
12	Right Rear Door	138.0	140	133	141
13	Right Back Panel	109.3	116	99	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Repair Mark - Yes / (R) Front Seat - Grime - Small / (R) Rear Trim - Grime - Large / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Crack, Gap - Medium / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Spare Tire. No spare key. No warranty booklet. No jack and tools. with seat cover. Traces of repair on right rear door and left front door.</p>