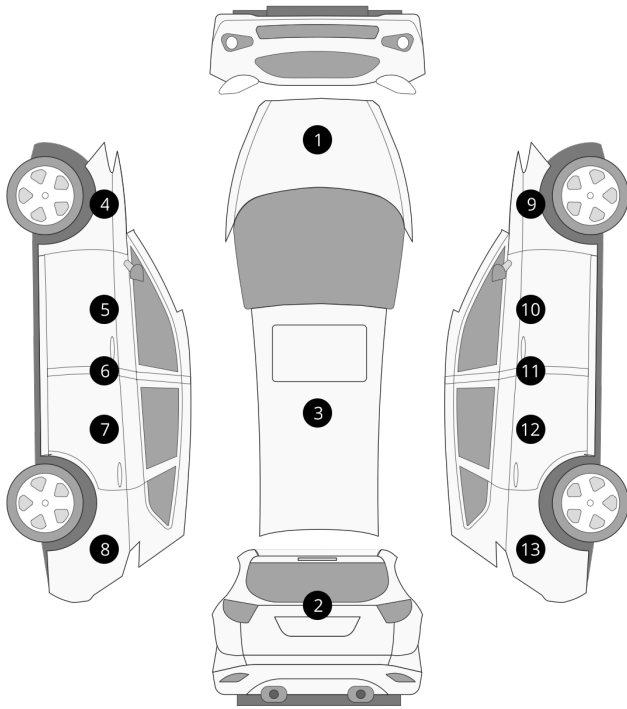


General Information

Date & Time: 04, Mar, 2026 15:46

Make	Hyundai	Model	Grand Starex
YOM	2015	Odo Meter Reading	181,595
Registration No.	ABE6627	Chassis No.	KMHWG81HAFU729683
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



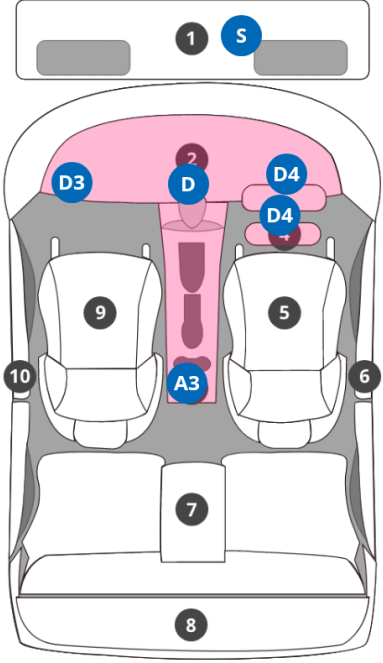
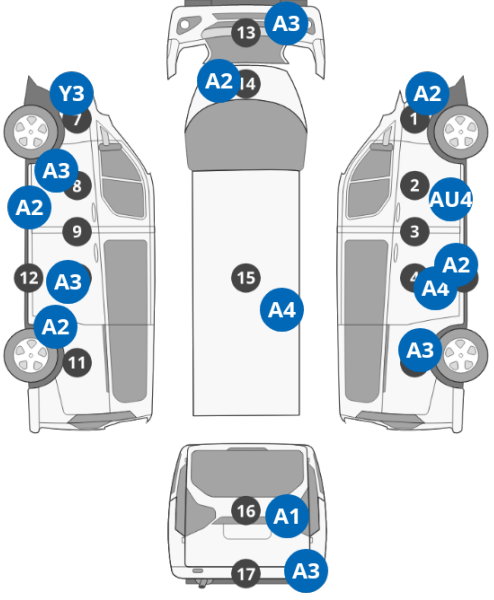
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	130	119	126
2	Boot Lid	107.0	104	109	108
3	Roof	113.7	114	125	104/112
4	Left Front Fender	99.5	95	112	92
5	Left Front Door	99.9	98	103	99
6	Center Panel Left				
7	Left Rear Door	104.1	98	119	96
8	Left Back Panel	112.3	105	125	107
9	Right Front Fender	108.4	94	108	123
10	Right Front Door	107.0	105	103	113
11	Center Panel Right				
12	Right Rear Door	110.6	109	120	103
13	Right Back Panel	105.6	103	107	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Dashboard - Loose, Deformed - Medium / (L) Front Floor Mat - Worked - Large / Glove Box - Loose, Deformed - Large / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with warranty/no reverse camera/with tools and jack/clutch issue/air-conditioning issue</p>