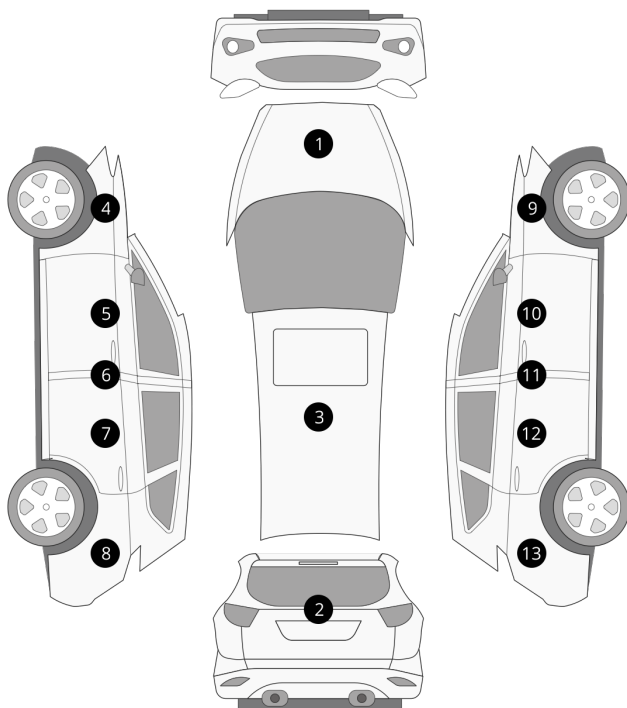


General Information

Date & Time: 05, Mar, 2026 10:06

Make	MG	Model	MG 5
YOM	2025	Odo Meter Reading	7,412
Registration No.	GBI3105	Chassis No.	LSJA36E38SZ609951
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



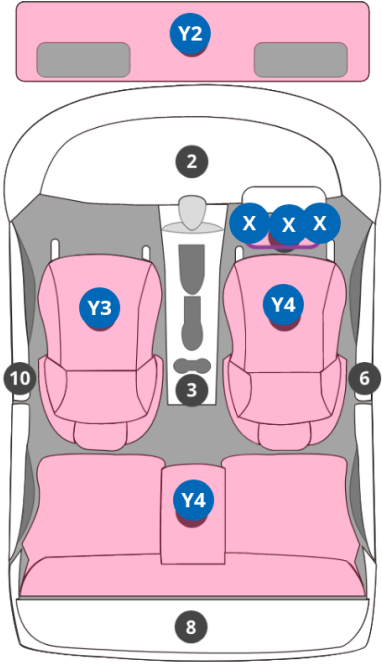
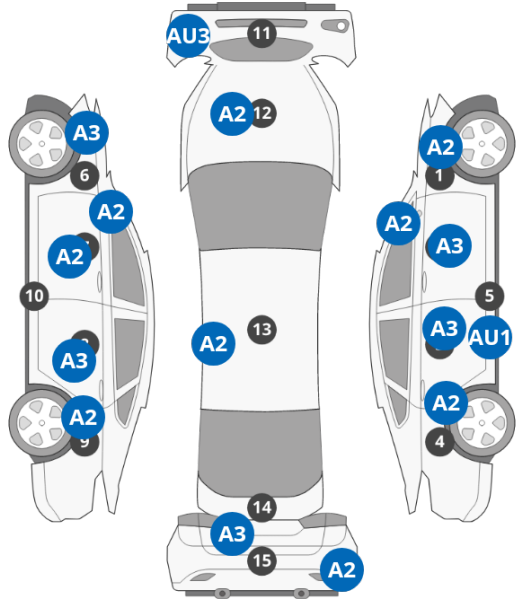
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	132	117	117
2	Boot Lid	139.3	135	141	142
3	Roof	129.2	131	140	124/122
4	Left Front Fender	120.6	116	126	120
5	Left Front Door	131.3	139	133	122
6	Center Panel Left				
7	Left Rear Door	135.0	142	136	127
8	Left Back Panel	133.0	129	121	149
9	Right Front Fender	125.0	126	125	124
10	Right Front Door	132.0	126	133	137
11	Center Panel Right				
12	Right Rear Door	180.0	168	190	182
13	Right Back Panel	135.0	144	130	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Large / Ceiling - Grime - Small / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium	Remarks (R) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
Window lock switch issue. Left reverse light busted. Plate light busted. With warranty booklet, spare tire and jack. Without tools and seat cover. 2 keys. With LTO plate.