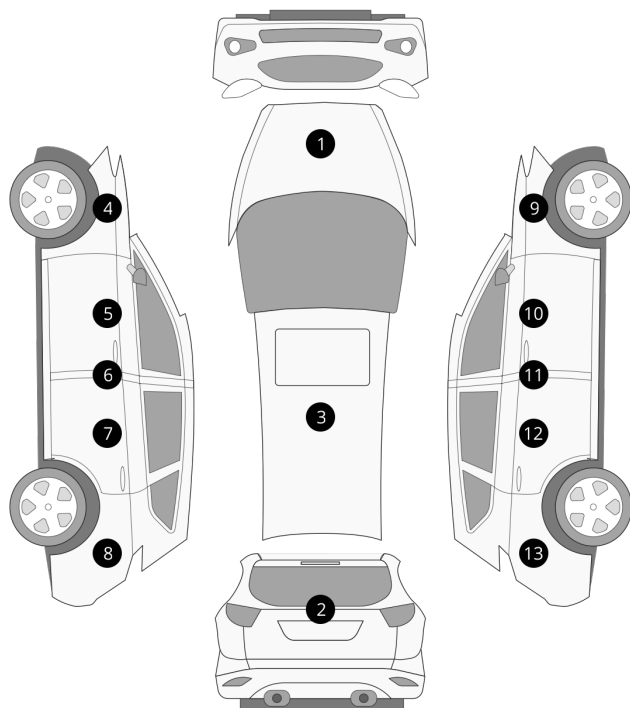


General Information

Date & Time: 04, Feb, 2025 14:59

Make	Toyota	Model	Vios
YOM	2022	Mileage	72,960
Registration No.	CBE1925	Chassis No.	PA1B18F3N4188676
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



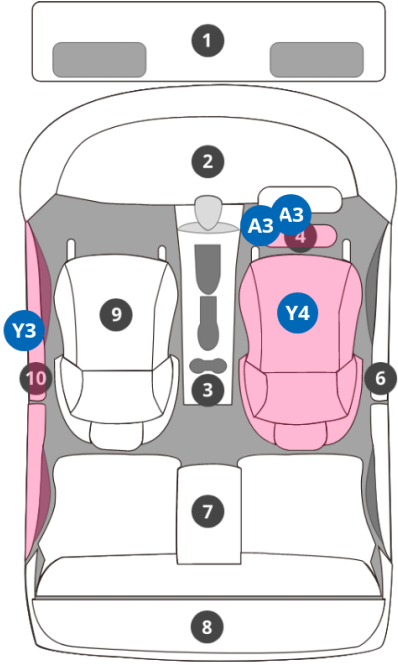
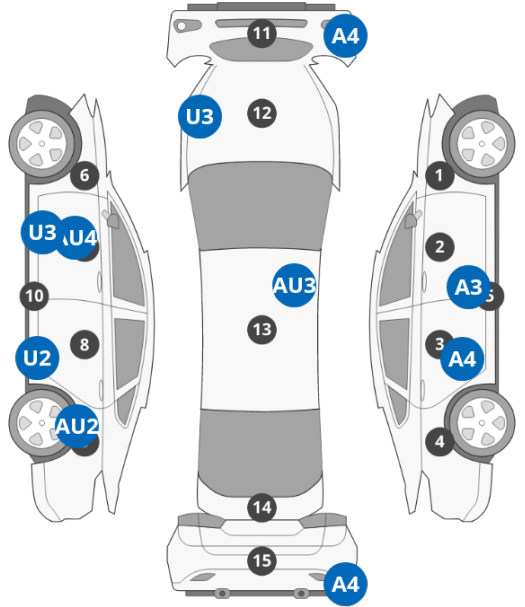
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	103	107	111
2	Boot Lid	106.9	111	100	110
3	Roof	97.5	100	92	101/97
4	Left Front Fender	97.3	103	94	95
5	Left Front Door	519.6	142	813	604
6	Center Panel Left				
7	Left Rear Door	775.0	686	987	652
8	Left Back Panel	172.3	269	124	124
9	Right Front Fender	95.2	96	94	96
10	Right Front Door	96.3	93	98	98
11	Center Panel Right				
12	Right Rear Door	122.6	123	129	116
13	Right Back Panel	101.3	98	96	110

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Carpet - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Medium / (L) Rear Door, Molding - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Scratch & Dent - Medium
Frame Evaluation : D	Functional Evaluation : E
Remarks Left Center Pillar - Condition of Welding ? - Yes	Remarks Retractable Mirror - Issue - Yes / Panel, Meter - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
hazzard light not working/ plate light not working/ glitch on the reverse camera/ water marks on the engine/ mud on tail lights and head lights/ mud signs on carpet/ possible flooding / with LTO plate/ with spare tire and jack/ incomplete tools/