

General Information

Date & Time: 12, Mar, 2026 12:12

Make	MG	Model	ZS
YOM	2024	Odo Meter Reading	12,093
Registration No.	MBD6127	Chassis No.	LSJW74U38RZ099062
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



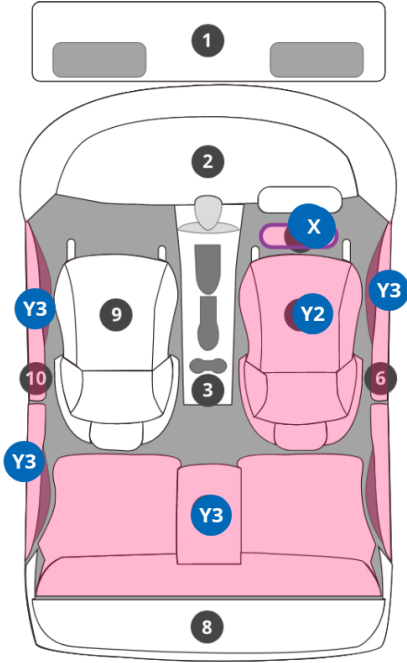
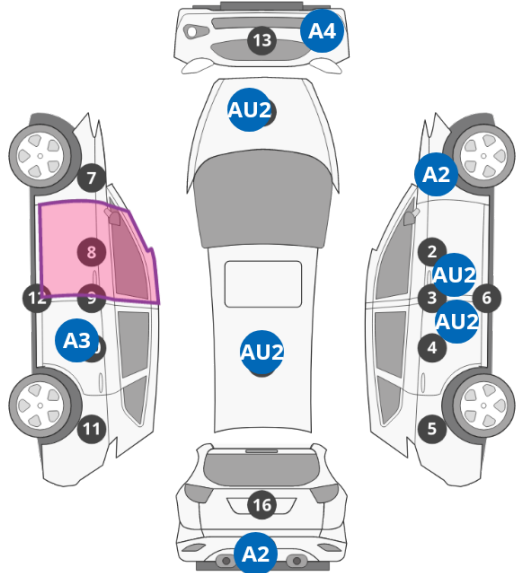
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	237.0	228	256	227
2	Boot Lid	251.6	249	260	246
3	Roof	233.5	217	235	237/245
4	Left Front Fender	208.0	164	218	242
5	Left Front Door	631.3	305	372	1,217
6	Center Panel Left				
7	Left Rear Door	242.3	229	234	264
8	Left Back Panel	258.0	265	245	264
9	Right Front Fender	224.0	241	225	206
10	Right Front Door	234.3	239	242	222
11	Center Panel Right				
12	Right Rear Door	240.0	247	231	242
13	Right Back Panel	251.0	244	244	265

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Partially Missing - Yes / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/with 1 spare key/with jack and tools/No reverse camera/No seat cover/front left side door handle missing/No warranty booklet/