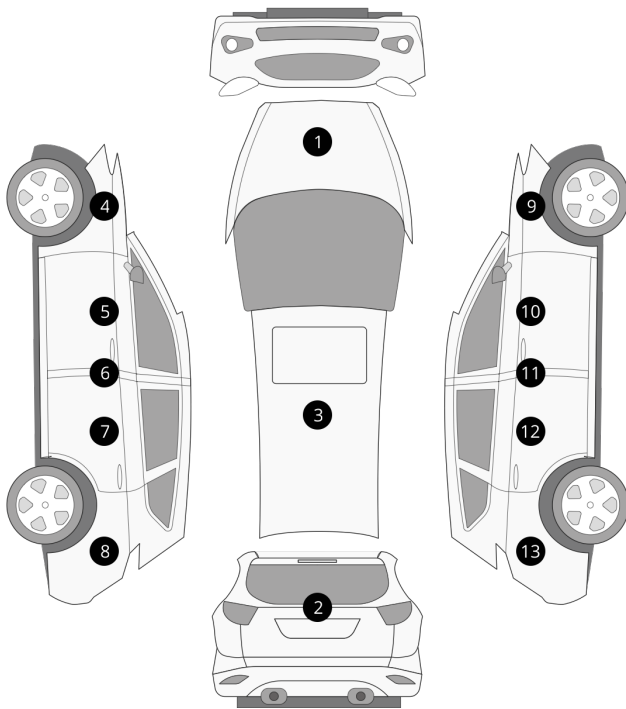


General Information

Date & Time: 09, Mar, 2026 15:09

Make	Hyundai	Model	H100
YOM	2025	Odo Meter Reading	4,877
Registration No.	NJC5912	Chassis No.	KMFZBX7KASU182881
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Shuttle
Colour	White		

Body / Panel Condition



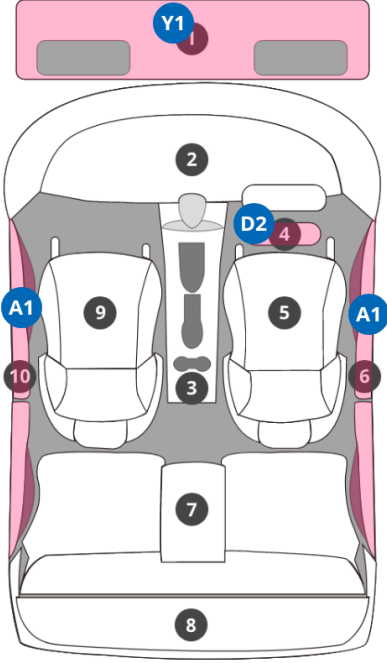
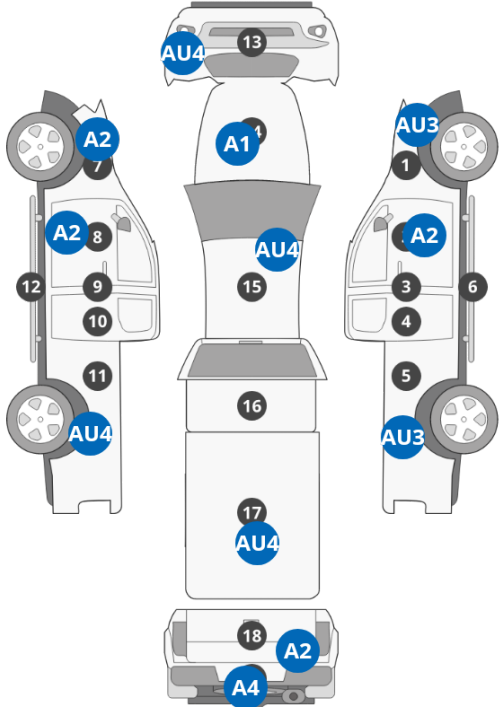
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	75.9	75	76	77
2	Boot Lid	87.3	75	74	113
3	Roof	81.4	80	80	84/82
4	Left Front Fender	82.7	83	84	81
5	Left Front Door	84.5	84	89	81
6	Center Panel Left	92.0	95	92	89
7	Left Rear Door				
8	Left Back Panel	95.6	123	86	78
9	Right Front Fender	78.5	79	77	79
10	Right Front Door	80.2	83	82	76
11	Center Panel Right	83.4	85	86	80
12	Right Rear Door				
13	Right Back Panel	100.3	77	116	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Cut, Crack - Minimal / Ceiling - Grime - Minimal	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Cargo Bed Floor - Scratch & Dent - Large / Rear Gate - Scratch - Small / (R) Side Gate - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
nojack and tools/ No warranty booklet/ with spare tire and LTO plate /