

General Information

Date & Time: 11, Mar, 2026 13:58

Make	Hyundai	Model	H100
YOM	2025	Odo Meter Reading	18,319
Registration No.	NJA9943	Chassis No.	KMFZBX7KASU179883
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Shuttle
Colour	White		

Body / Panel Condition



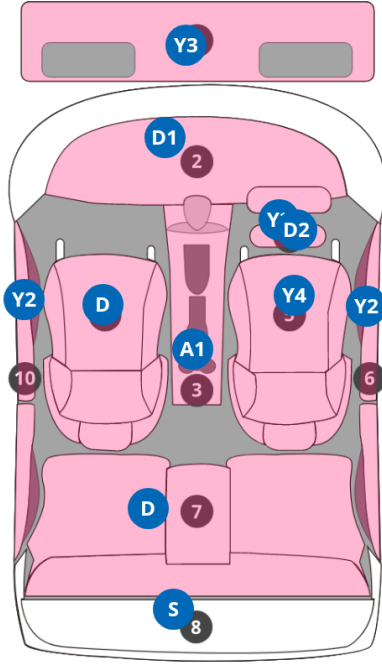
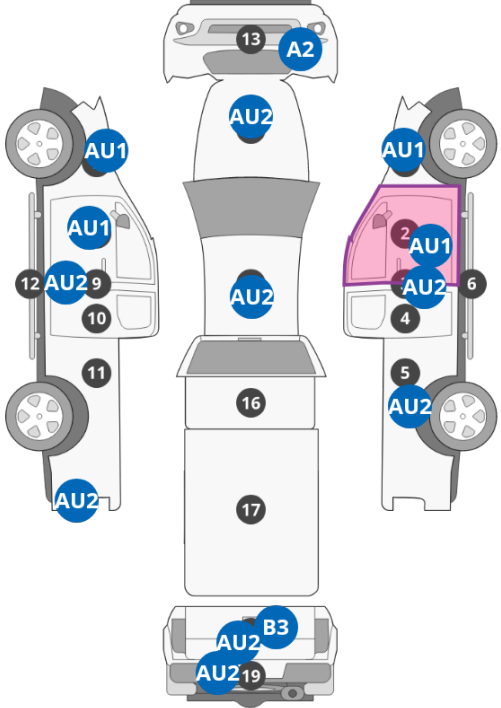
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	74.6	66	81	78
2	Boot Lid	122.2	136	97	134
3	Roof	84.8	81	81	88/90
4	Left Front Fender	84.7	97	77	81
5	Left Front Door	80.8	84	83	75
6	Center Panel Left	91.6	84	103	88
7	Left Rear Door				
8	Left Back Panel	109.6	119	92	118
9	Right Front Fender	82.9	83	77	89
10	Right Front Door	83.8	85	83	83
11	Center Panel Right	81.3	76	87	82
12	Right Rear Door				
13	Right Back Panel	152.0	148	158	150

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Worked - Small / Dashboard - Worked - Minimal / Overall Interior - Smell - Yes / Rear Seat - Worn - Yes / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Rear Corner Panel - Repair Traces - Yes / Front Panel - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Modified - Medium / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, with spare tire, with inc tools & jack, with spare key, no warranty and manual booklet, scratches on taillight and headlight.