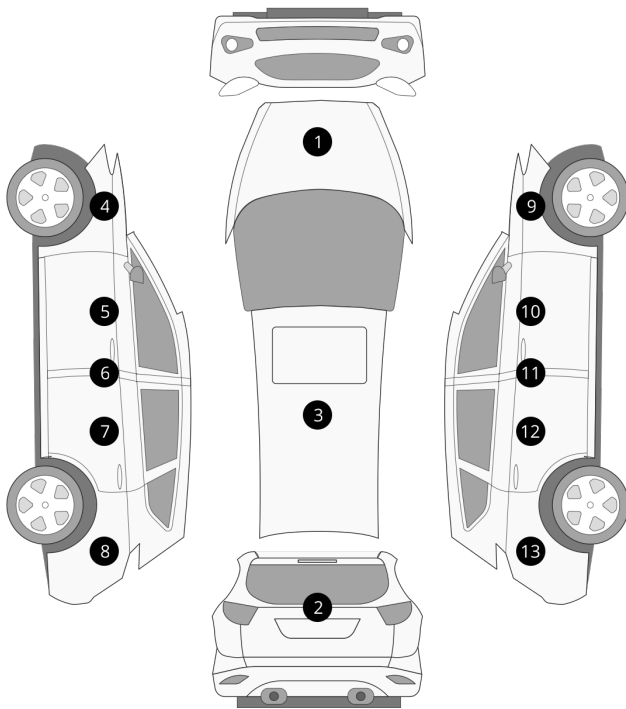


General Information

Date & Time: 13, Apr, 2026 16:04

Make	Ford	Model	Explorer
YOM	2013	Odo Meter Reading	98,014
Registration No.	WOU425	Chassis No.	1FM5K7F93DGC84392
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Green		

Body / Panel Condition



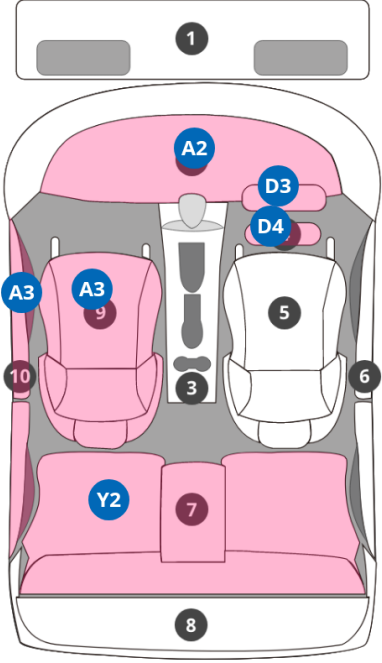
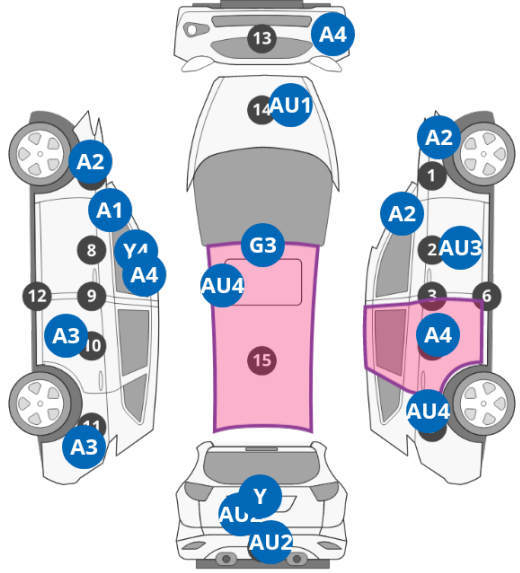
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	164.0	148	191	153
2	Boot Lid	122.0	123	130	113
3	Roof	129.5	138	127	127/126
4	Left Front Fender	216.6	198	240	212
5	Left Front Door	175.6	185	160	182
6	Center Panel Left				
7	Left Rear Door	179.3	193	168	177
8	Left Back Panel	167.6	177	170	156
9	Right Front Fender	224.0	203	257	212
10	Right Front Door	171.0	168	162	183
11	Center Panel Right				
12	Right Rear Door	168.0	158	171	175
13	Right Back Panel	178.3	159	173	203

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Loose, Deformed - Medium / (L) Front Trim - Cut, Crack - Medium / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Seat - Cut, Crack - Medium / Rear Seat - Grime - Small / Carpet - Worked - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Antennae - Damaged - Yes / Roof - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Medium / Roof - Scratch & Dent - Large / (L) Side Window - Damaged - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Front Windshield - Scratch, Stone chip - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, battery weak, non moving vehicles, vehicle not starting, Crack windows, scratches on front windshield