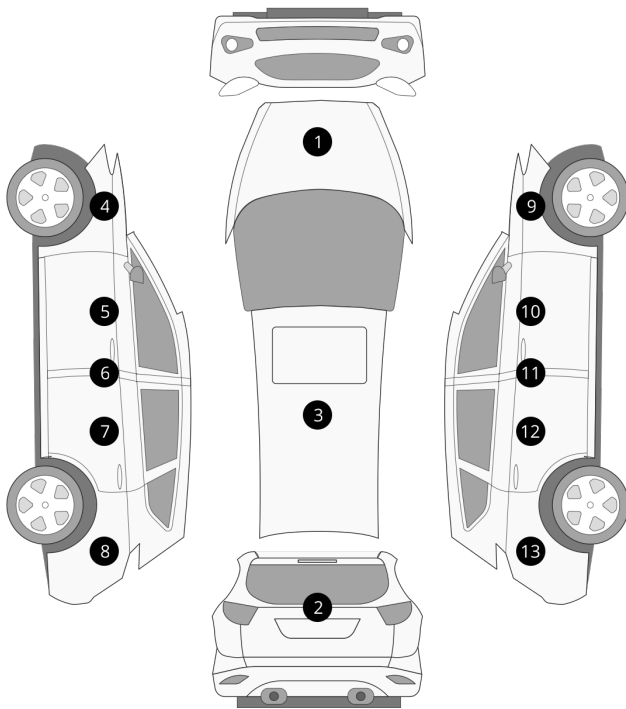


General Information

Date & Time: 27, Mar, 2026 23:43

Make	Nissan	Model	NV350
YOM	2019	Odo Meter Reading	93,842
Registration No.	NEC3582	Chassis No.	JNT1TC2E26Z0055941
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



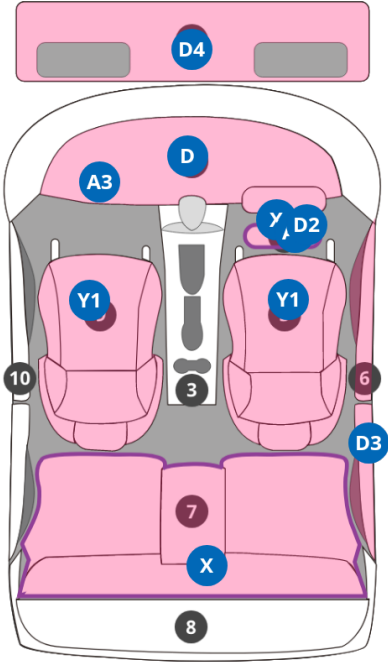
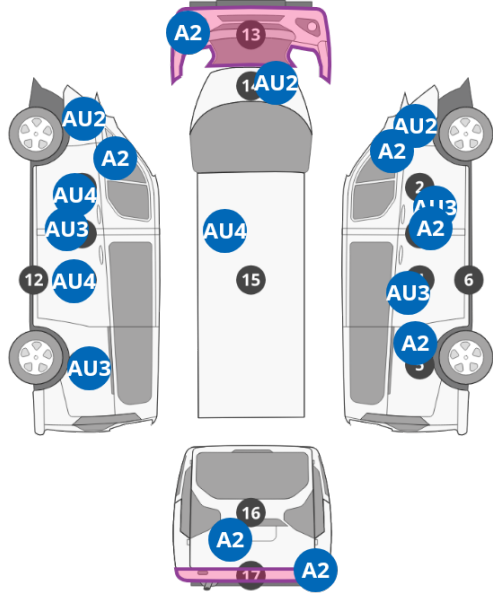
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	326.3	321	340	318
2	Boot Lid	328.0	421	316	247
3	Roof	164.5	151	179	149/179
4	Left Front Fender	203.0	230	217	162
5	Left Front Door	215.6	383	123	141
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	295.3	274	296	316
9	Right Front Fender	365.6	307	332	458
10	Right Front Door	182.0	182	193	171
11	Center Panel Right	403.0	666	262	281
12	Right Rear Door	275.6	257	280	290
13	Right Back Panel	234.0	256	246	200

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Missing - Yes / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Cut, Crack - Small / (R) Front Floor Mat - Worked - Small / Room Mirror - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (R) Rear Trim - Loose, Deformed - Medium / Ceiling - Crinkle - Large / Steering Wheel - Worn, Peel, Crack - Medium / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Re-Paint Uneven - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Center Panel - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch & Dent - Small / Roof - Scratch & Dent - Large
Frame Evaluation : B	Functional Evaluation : A
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, jack and tools, with spare tire, with LTO plate, fog lamps issue, interior rear view mirror missing, last row rear seat missing, door sensor issue, scratches on headlight and tail light,