

General Information

Date & Time: 30, Mar, 2026 13:21

Make	Suzuki	Model	Ertiga
YOM	2023	Odo Meter Reading	39,376
Registration No.	NNV2519	Chassis No.	MHYNC32S8PJ103230
CC	1.5	Transmission	M/T
Fuel Type	Hybrid	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



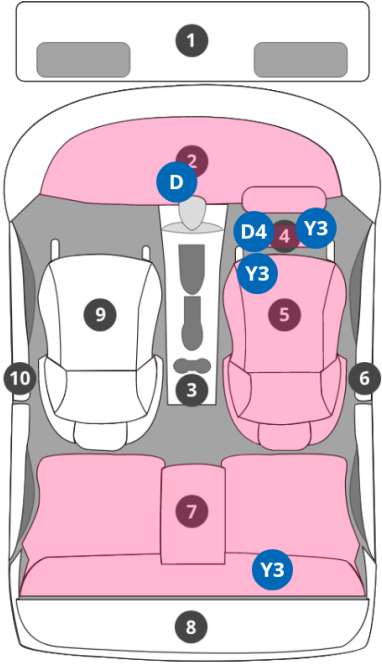
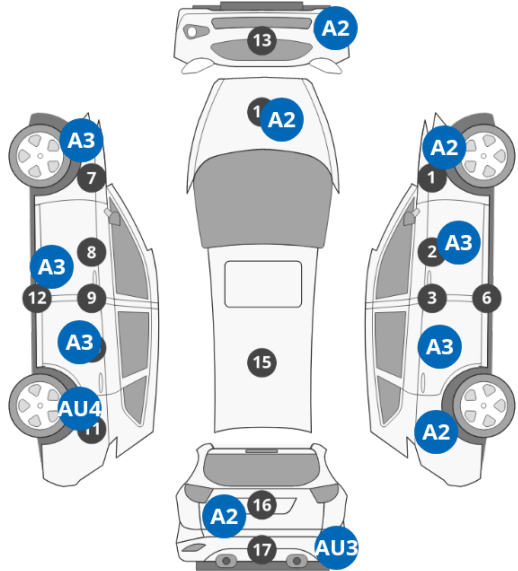
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.1	98	93	97
2	Boot Lid	90.6	89	93	90
3	Roof	95.8	88	98	100/98
4	Left Front Fender	83.2	83	85	82
5	Left Front Door	100.9	101	100	102
6	Center Panel Left				
7	Left Rear Door	101.2	100	95	109
8	Left Back Panel	94.7	95	97	93
9	Right Front Fender	80.6	85	78	79
10	Right Front Door	99.3	96	94	108
11	Center Panel Right				
12	Right Rear Door	95.4	95	93	99
13	Right Back Panel	88.6	89	86	91

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Large	Remarks (L) Front Fender, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no jack and tools/possible flooding/ with spare tire and LTO plate / with warranty booklet/