

General Information

Date & Time: 15, Apr, 2026 17:29

Make	Hyundai	Model	Stargazer
YOM	2025	Odo Meter Reading	32,611
Registration No.	NKJ5339	Chassis No.	MF3NB81DERJ060177
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



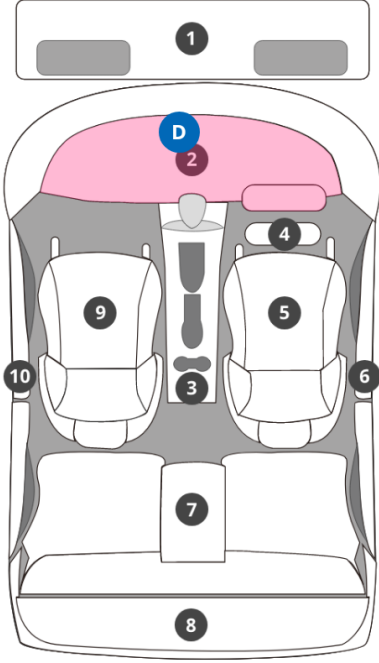
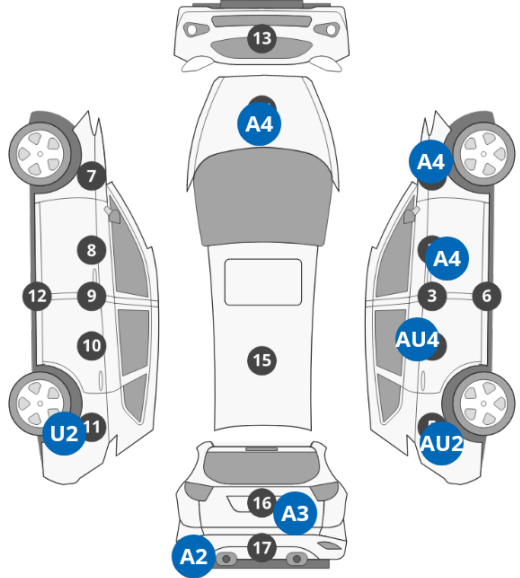
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	115	113	126
2	Boot Lid	102.3	102	104	101
3	Roof	115.5	119	106	118/119
4	Left Front Fender	96.0	89	107	92
5	Left Front Door	129.3	133	130	125
6	Center Panel Left				
7	Left Rear Door	120.6	128	116	118
8	Left Back Panel	117.6	115	116	122
9	Right Front Fender	100.3	117	98	86
10	Right Front Door	122.0	118	120	128
11	Center Panel Right				
12	Right Rear Door	124.3	123	121	129
13	Right Back Panel	124.6	118	128	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Bonnet, Headlight - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
rear window issue/ no tools/ no warranty booklet/ with jack and spare tire/ with LTO plate/