


General Information

Date & Time: 16, Apr, 2026 10:22

Make	Geely	Model	Coolray
YOM	2023	Odo Meter Reading	30,370
Registration No.	CAZ9383	Chassis No.	LB37622Z3PX411629
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition

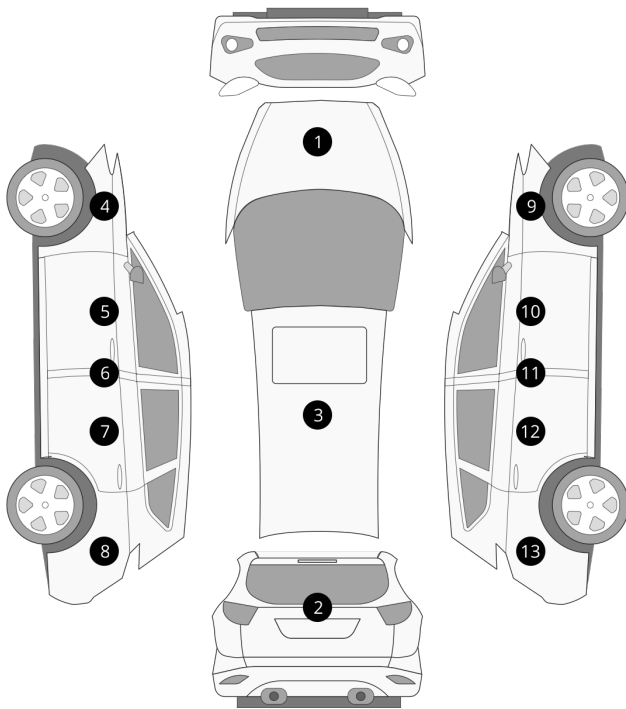

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.3	151	168	114
2	Boot Lid	132.0	130	142	124
3	Roof	123.2	120	133	119/121
4	Left Front Fender	127.0	125	135	121
5	Left Front Door	150.0	129	179	142
6	Center Panel Left				
7	Left Rear Door	130.0	142	116	132
8	Left Back Panel	125.0	136	121	118
9	Right Front Fender	182.3	171	170	206
10	Right Front Door	163.6	152	154	185
11	Center Panel Right				
12	Right Rear Door	136.6	136	125	149
13	Right Back Panel	143.0	133	141	155

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / (R) Rear Trim - Worked - Small / Dashboard - Worked - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate, with spare tire, with jack, with reverse camera, with manual and warranty booklet, light scratches on exterior, rear left door window issue and door lock, no spare key, scratches on taillight and headlight.