

General Information

Date & Time: 17, Apr, 2026 07:42

Make	Mitsubishi	Model	L300
YOM	2025	Odo Meter Reading	4,563
Registration No.	NKP1930	Chassis No.	PAEL65NYSSB002749
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



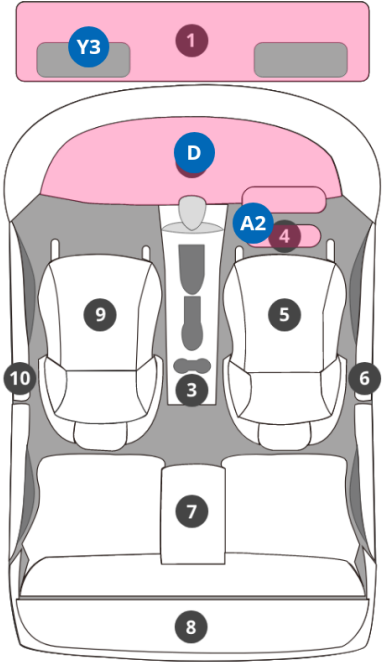
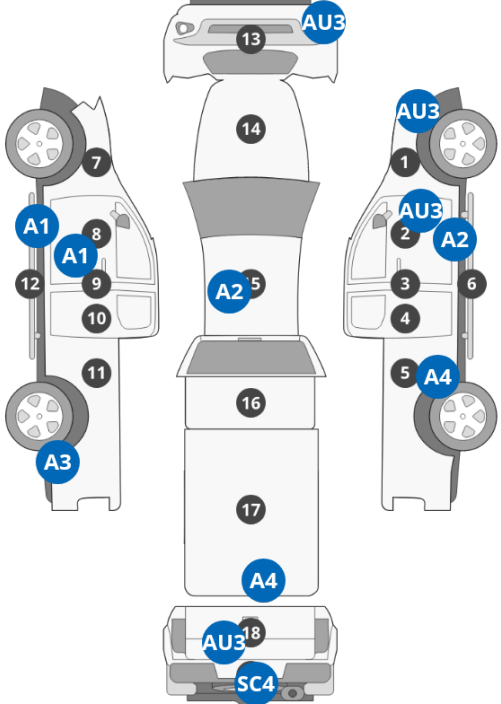
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	79.6	84	74	81
2	Boot Lid	66.4	83	56	61
3	Roof	67.1	65	68	67/68
4	Left Front Fender	77.2	78	72	82
5	Left Front Door	70.2	74	67	70
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	74.1	62	86	75
9	Right Front Fender	75.9	71	77	80
10	Right Front Door	74.2	73	76	74
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	71.0	57	66	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Carpet - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Medium	Remarks (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Medium / (R) Side Gate - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / Cargo Bed Floor - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With LTO plate/with warranty booklet/no tools and jack/no spare tire/hairline scratches on the body