

General Information

Date & Time: 18, Apr, 2026 15:58

Make	Toyota	Model	Innova
YOM	2018	Odo Meter Reading	59,759
Registration No.	DAG1131	Chassis No.	PA2GA8EM4H0032886
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



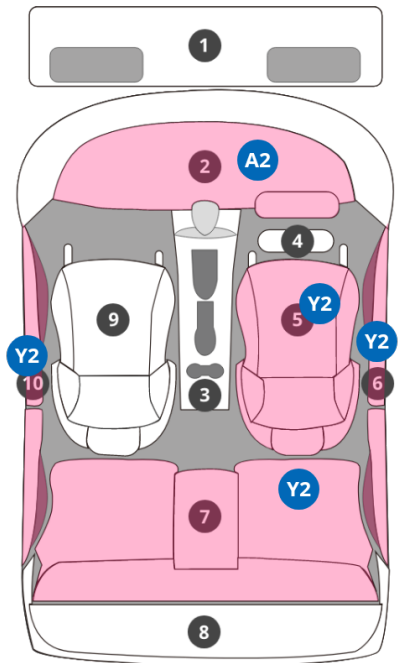
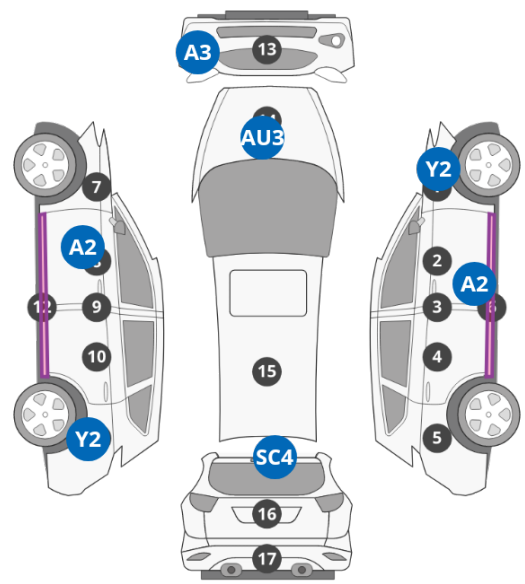
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	115	109	109
2	Boot Lid	62.0	60	62	64
3	Roof	85.1	91	94	79/77
4	Left Front Fender	231.0	236	218	239
5	Left Front Door	233.3	161	157	382
6	Center Panel Left				
7	Left Rear Door	407.6	868	171	184
8	Left Back Panel	239.0	258	258	201
9	Right Front Fender	269.0	255	346	206
10	Right Front Door	146.0	132	136	170
11	Center Panel Right				
12	Right Rear Door	146.0	148	134	156
13	Right Back Panel	185.0	153	207	195

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Replaced - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Rust, Corrosion - Large / (L) Rear Fender, Molding - Crack, Gap - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Crack, Gap - Small / (R) Front Door, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Horn - Issue - Yes

Inspector Notes
Dead Battery. With Spare tire. with spare key. No jack and tools. No Warranty Booklet. No seat cover