

General Information

Date & Time: 18, Apr, 2026 15:56

Make	Hyundai	Model	Accent
YOM	2016	Odo Meter Reading	76,216
Registration No.	NDD3964	Chassis No.	KMHCT41BEHU190234
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



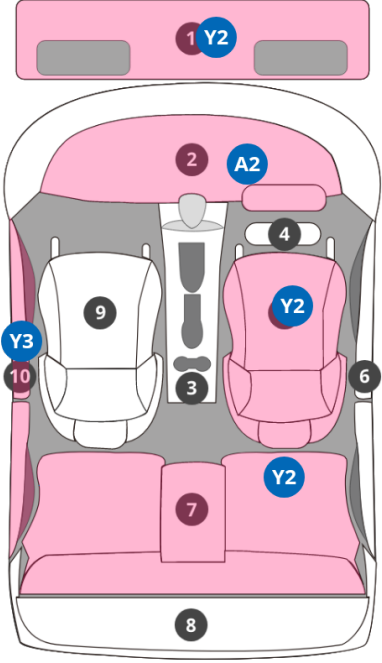
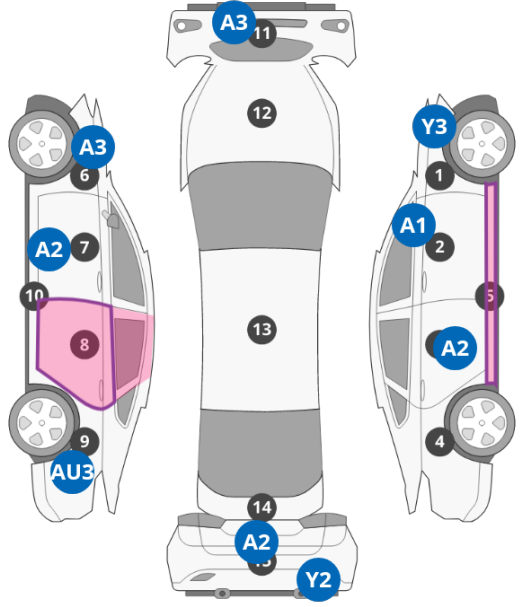
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	107	105	119
2	Boot Lid	130.3	123	143	125
3	Roof	116.3	143	130	101/91
4	Left Front Fender	129.0	122	130	135
5	Left Front Door	179.3	131	143	264
6	Center Panel Left				
7	Left Rear Door	420.3	617	366	278
8	Left Back Panel	134.6	150	121	133
9	Right Front Fender	124.3	131	124	118
10	Right Front Door	156.0	170	149	149
11	Center Panel Right				
12	Right Rear Door	461.6	439	632	314
13	Right Back Panel	227.6	180	199	304

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch, Peeled - Minimal
Frame Evaluation : D	Functional Evaluation : C
Remarks Left Center Pillar - Condition of Welding ? - Yes	Remarks Air Conditioner - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Air-conditioned not functioning. with Spare tire. With spare key. no Jack and tools. No Warranty booklet. No seatcover