

General Information

Date & Time: 23, Apr, 2026 18:54

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	43,554
Registration No.	DAR4112	Chassis No.	PA1B18F38N4183038
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



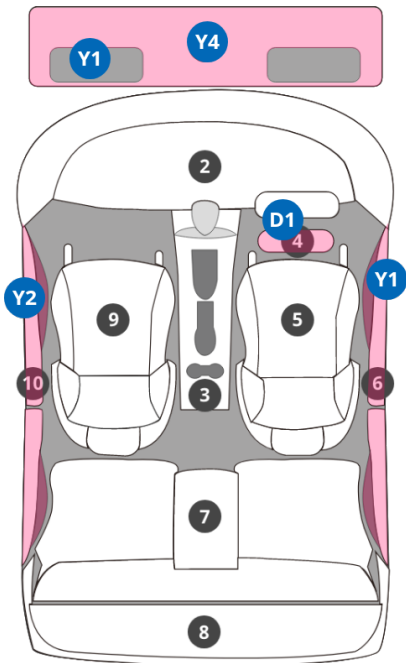
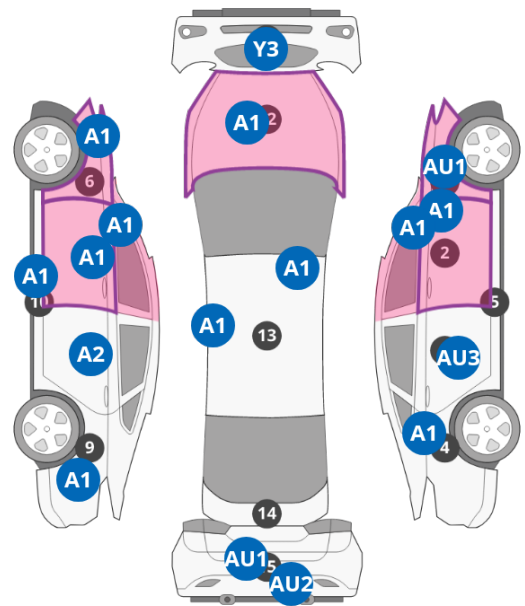
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	192.0	174	216	186
2	Boot Lid	114.0	117	106	119
3	Roof	100.6	111	94	100/98
4	Left Front Fender	867.3	621	721	1,260
5	Left Front Door	153.6	164	157	140
6	Center Panel Left				
7	Left Rear Door	192.3	183	194	200
8	Left Back Panel	187.6	190	187	186
9	Right Front Fender	808.3	1,103	461	861
10	Right Front Door	395.6	186	163	838
11	Center Panel Right				
12	Right Rear Door	160.3	165	141	175
13	Right Back Panel	162.3	147	156	184

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Trim - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Trim - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof Spoiler, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Air Conditioner - Function - Weak / Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

With Lto plate, with spare tire and tools, with jack, 2keys, no warranty booklet, scratches on headlights and taillights, unusual noise on engine, aircon issue,foul smell