

General Information

Date & Time: 23, Apr, 2026 10:29

Make	Hyundai	Model	Accent
YOM	2014	Odo Meter Reading	123,670
Registration No.	AAF4567	Chassis No.	KMHCT51UBEU149901
CC	1.6	Transmission	A/T
Fuel Type	Diesel	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



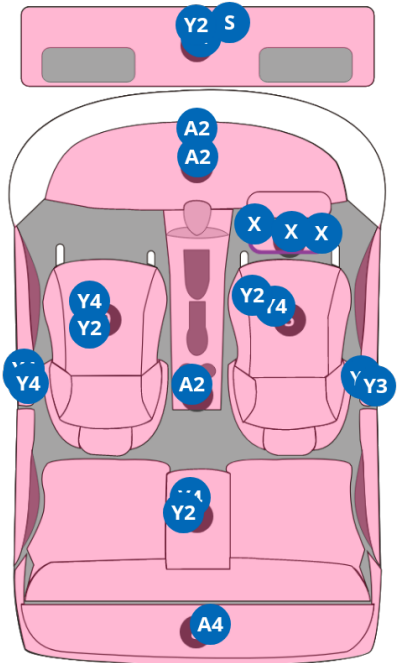
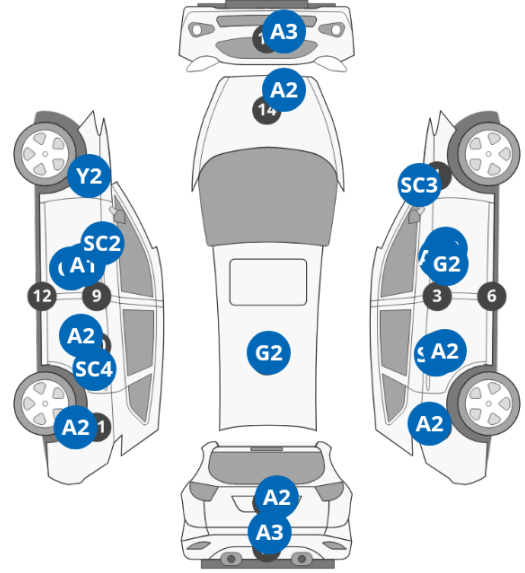
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	181.0	185	173	185
2	Boot Lid	152.3	154	146	157
3	Roof	168.7	210	159	162/144
4	Left Front Fender	234.6	247	248	209
5	Left Front Door	199.6	210	189	200
6	Center Panel Left				
7	Left Rear Door	318.6	228	370	358
8	Left Back Panel	309.3	313	299	316
9	Right Front Fender	210.0	214	200	216
10	Right Front Door	193.0	203	192	184
11	Center Panel Right				
12	Right Rear Door	613.0	919	630	290
13	Right Back Panel	230.6	212	226	254

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Animal Hair - Yes / Overall Interior - Smell - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Large / (L) Front Seat belt - Grime - Small / (L) Front Trim - Grime - Medium / Trim Other - Grime - Large / (L) Rear Trim - Grime - Large / Knobs - Worn, Peel, Crack - Small / (R) Front Seat - Grime - Large / (R) Front Seat belt - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Large / Trim Other - Grime - Medium / Rear Seat - Grime - Large / Ceiling - Grime - Small / Seat belt Other - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Rust, Corrosion - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Rust, Corrosion - Medium / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Side Window - Scratch, Stone chip - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Rust, Corrosion - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Window - Scratch, Stone chip - Small / (L) Mirror - Scratch, Peeled - Minimal / (L) Front Door, Molding - Rust, Corrosion - Small / (L) Front Fender, Molding - Crack, Gap - Small / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooded. Check engine warning lamp on, steering wheel lamp on, power steering issue, both low/high beam busted, right signal light busted, engine leak, left side signal light missing, no tail light, crack on right side tail light, engine abnormal sound, right rear door power window issue, adhesive tape in roof and front windshield, visible hairline scratches, blower fan and Air-conditioning Issue. Without jack, tools, seatcover, warranty booklet. With LTO plate and spare tire, 1key.