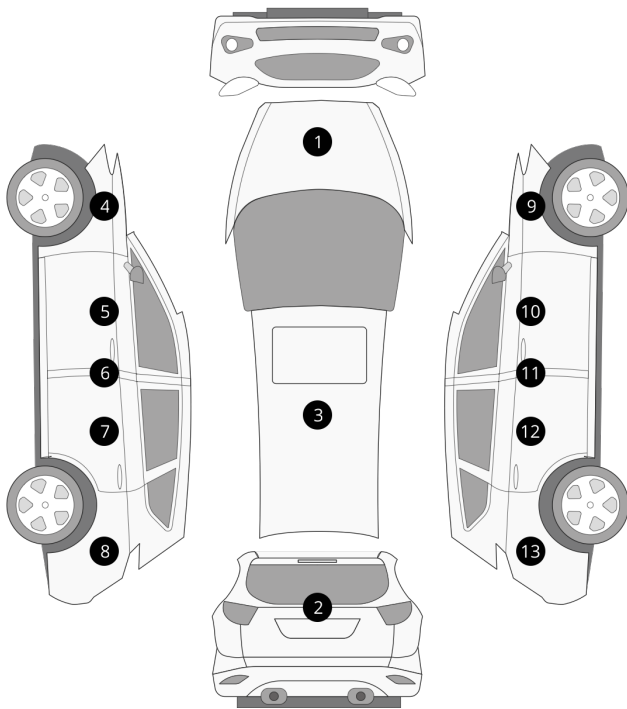


## General Information

Date & Time: 27, Apr, 2026 14:37

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Innova            |
| YOM              | 2025    | Odo Meter Reading | 66,044            |
| Registration No. | DBR1847 | Chassis No.       | PA2JA8EM8R0150849 |
| CC               | 2.8     | Transmission      | A/T               |
| Fuel Type        | Diesel  | Type of Body      | Wagon             |
| Colour           | Black   |                   |                   |

## Body / Panel Condition



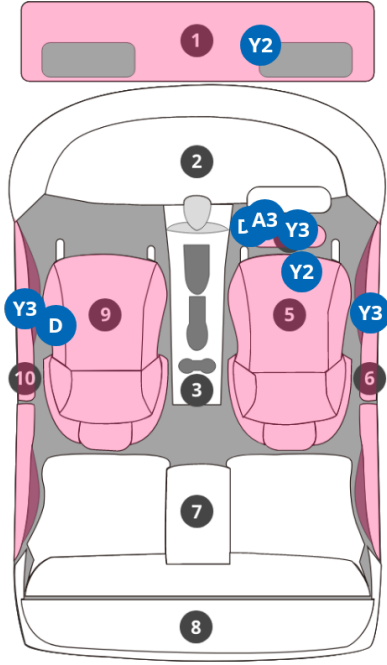
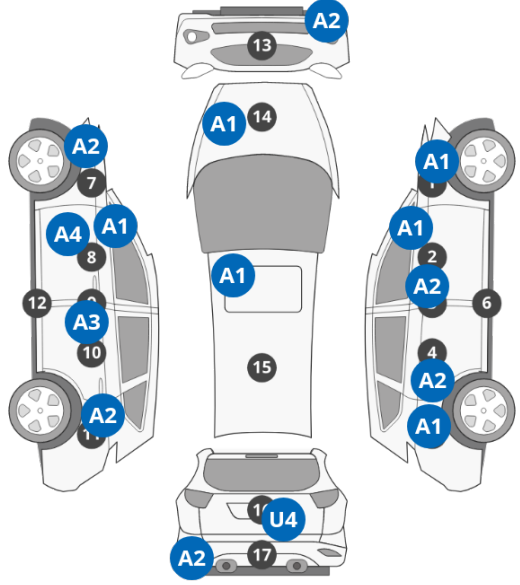
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 110.6         | 104    | 125    | 103      |
| 2  | Boot Lid           | 184.0         | 227    | 166    | 159      |
| 3  | Roof               | 98.9          | 97     | 101    | 90/108   |
| 4  | Left Front Fender  | 106.6         | 104    | 115    | 101      |
| 5  | Left Front Door    | 111.3         | 104    | 119    | 111      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 108.6         | 114    | 112    | 100      |
| 8  | Left Back Panel    | 108.8         | 92     | 114    | 121      |
| 9  | Right Front Fender | 113.3         | 101    | 126    | 113      |
| 10 | Right Front Door   | 112.6         | 122    | 108    | 108      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 242.0         | 264    | 206    | 256      |
| 13 | Right Back Panel   | 115.6         | 121    | 109    | 117      |

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                                                           | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                           |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <b>Remarks</b><br>(L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Cut, Crack - Medium / Mat Other - Grime - Medium / Ceiling - Grime - Small | <b>Remarks</b><br>Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                              | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                          | <b>Remarks</b><br>Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |

| Inspector Notes                                                                                                       |
|-----------------------------------------------------------------------------------------------------------------------|
| no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, brake light issue |