


## General Information

Date & Time: 30, Apr, 2026 12:42

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2023    | Odo Meter Reading | 31,000            |
| Registration No. | DBI3891 | Chassis No.       | PA11B8F3XP4218850 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Black   |                   |                   |

## Body / Panel Condition

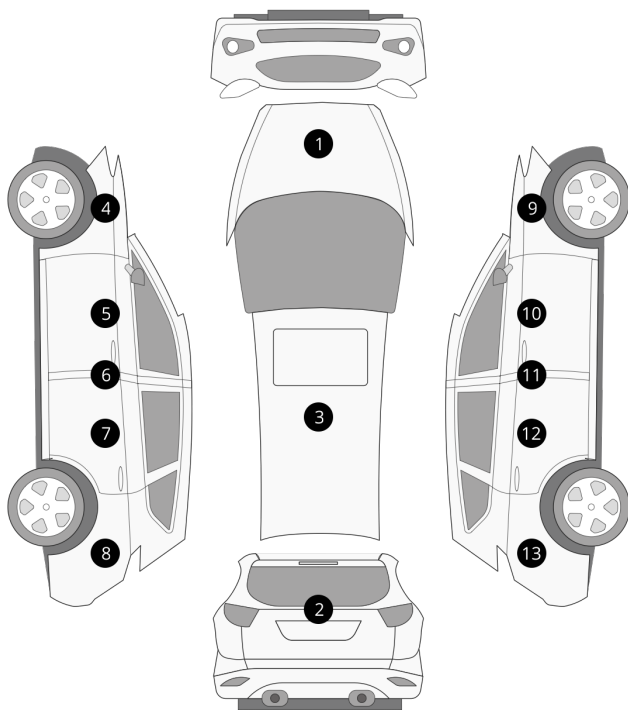

| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 115.3         | 125    | 110    | 111      |
| 2  | Boot Lid           | 122.6         | 112    | 135    | 121      |
| 3  | Roof               | 100.7         | 108    | 96     | 103/96   |
| 4  | Left Front Fender  | 105.3         | 108    | 99     | 109      |
| 5  | Left Front Door    | 108.3         | 114    | 108    | 103      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 111.0         | 111    | 109    | 113      |
| 8  | Left Back Panel    | 114.6         | 115    | 112    | 117      |
| 9  | Right Front Fender | 159.6         | 153    | 156    | 170      |
| 10 | Right Front Door   | 104.0         | 107    | 97     | 108      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 110.6         | 108    | 102    | 122      |
| 13 | Right Back Panel   | 120.6         | 114    | 117    | 131      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| <div>Interior Evaluation :</div> <div>B</div>                                                                                                                                                                                                         | <div>Exterior Evaluation :</div> <div>D</div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <div data-bbox="234 383 624 1041"> </div> <div data-bbox="63 1090 793 1158"> <p> <b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain </p> </div> | <div data-bbox="908 398 1431 999"> </div> <div data-bbox="798 1077 1528 1171"> <p> <b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap </p> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <div>Remarks</div> <div>Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal / Dashboard - Loose, Deformed - Medium</div>           | <div>Remarks</div> <div>(R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Tyre - Crack, Cut - Yes / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium</div> |
| <div>Frame Evaluation :</div> <div>A</div>                                                                                                                                                                                                            | <div>Functional Evaluation :</div> <div>A</div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <div>Remarks</div> <div>Defects not found</div>                                                                                                                                                                                                       | <div>Remarks</div> <div>Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |

## Inspector Notes

With Lto plate, with warranty booklet and tools, with spare tire and jack, 1key, scratches on headlights, Crack taillight