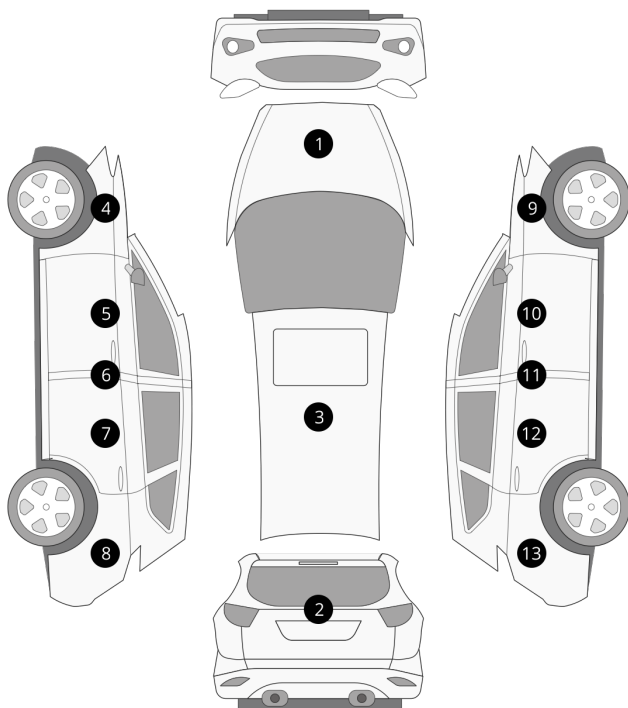


General Information

Date & Time: 25, Apr, 2026 16:11

Make	Nissan	Model	Almera
YOM	2017	Odo Meter Reading	69,783
Registration No.	NAB8426	Chassis No.	BDUALBAH17B50475
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



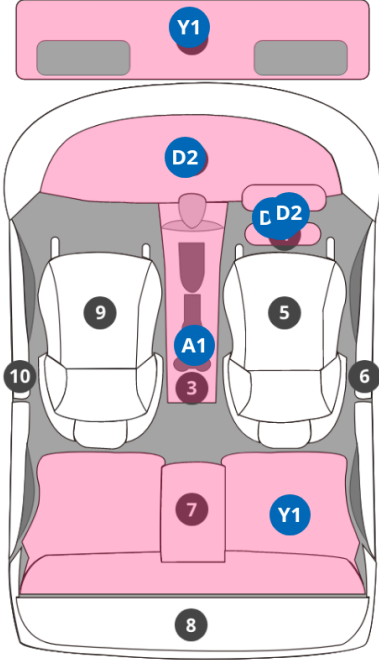
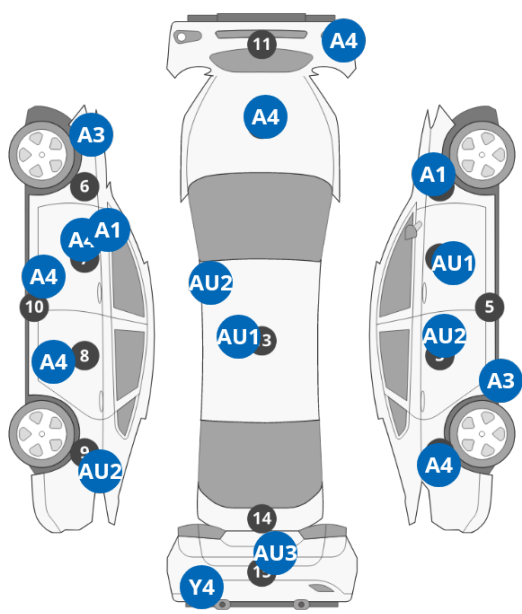
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	187.3	203	186	173
2	Boot Lid	100.8	106	85	111
3	Roof	103.5	117	100	106/91
4	Left Front Fender	233.3	228	207	265
5	Left Front Door	154.3	154	154	155
6	Center Panel Left				
7	Left Rear Door	69.8	69	65	76
8	Left Back Panel	271.3	161	173	480
9	Right Front Fender	395.0	280	259	646
10	Right Front Door	101.3	101	101	102
11	Center Panel Right				
12	Right Rear Door	105.6	103	100	114
13	Right Back Panel	115.0	125	109	111

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Loose, Deformed - Small / Carpet - Worked - Minimal / (L) Front Floor Mat - Worked - Large / Rear Seat - Grime - Minimal / (R) Front Floor Mat - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / Roof Spoiler, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Large / Roof - Scratch & Dent - Minimal
Frame Evaluation : C	Functional Evaluation : D
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights, Crack taillight, plate light issue, aircon issue, check engine warning lamp on