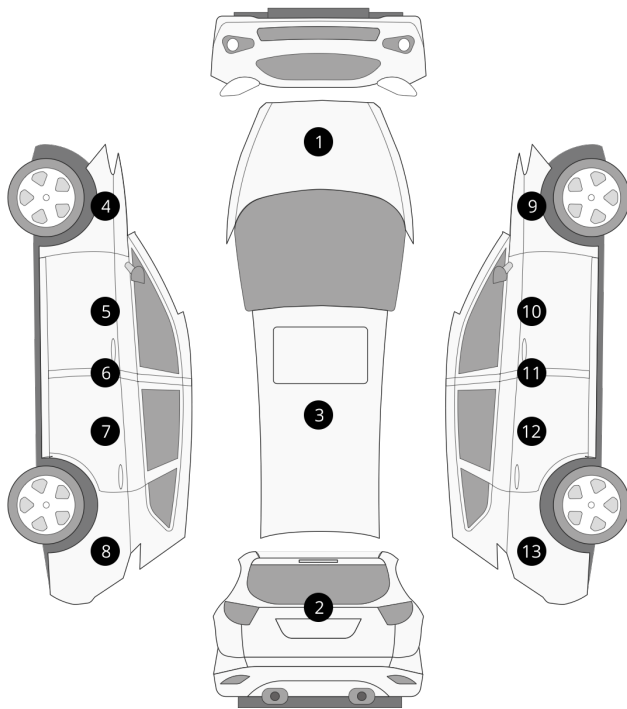


General Information

Date & Time: 04, May, 2026 11:10

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	147,062
Registration No.	NIH2669	Chassis No.	PA1B18F38N4199292
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



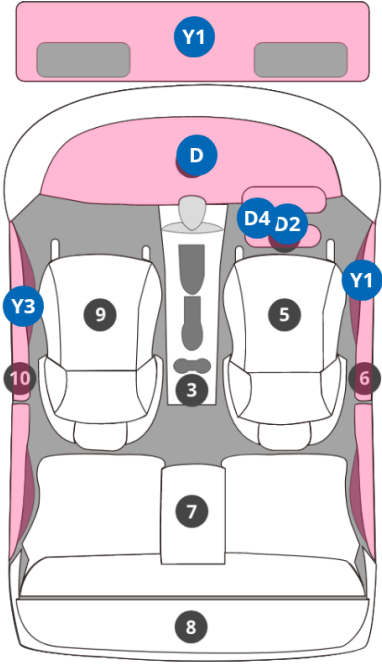
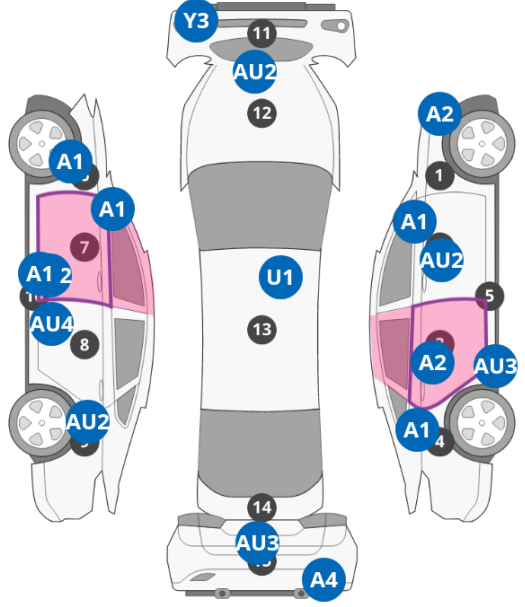
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	126	111	110
2	Boot Lid	158.0	165	161	148
3	Roof	99.7	105	100	94/100
4	Left Front Fender	150.6	142	139	171
5	Left Front Door	728.3	1,060	860	265
6	Center Panel Left				
7	Left Rear Door	204.6	227	173	214
8	Left Back Panel	162.0	174	150	162
9	Right Front Fender	107.3	110	108	104
10	Right Front Door	107.6	116	106	101
11	Center Panel Right				
12	Right Rear Door	211.6	185	211	239
13	Right Back Panel	106.0	101	100	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire, with jack and tools, 3keys, no warranty booklet, scratches on headlights, Crack taillight, Worn out tires