

General Information

Date & Time: 21, May, 2026 05:41

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	57,202
Registration No.	CBL1404	Chassis No.	PA1B18F38L4128414
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



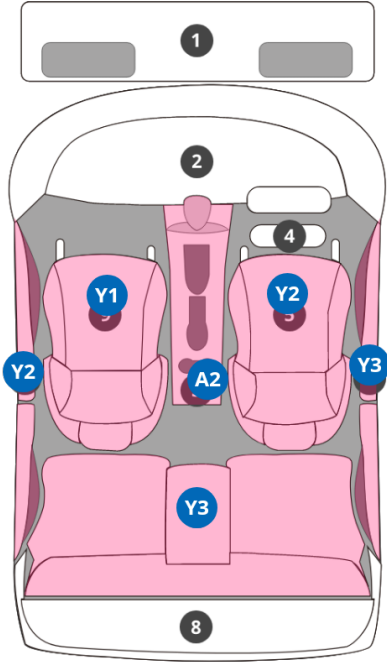
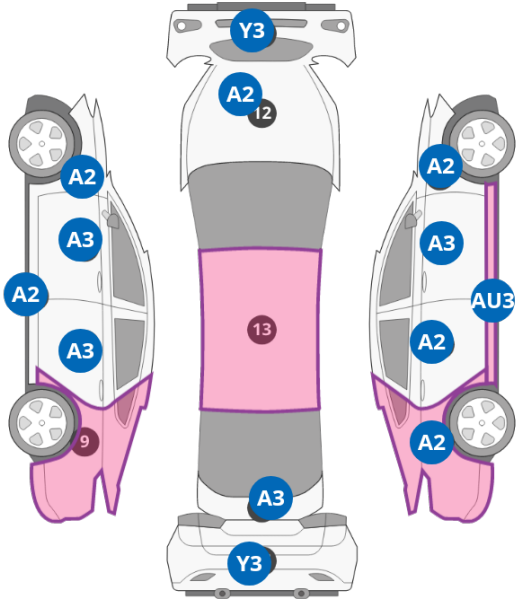
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	195.6	198	192	197
2	Boot Lid	293.6	276	334	271
3	Roof	195.2	204	181	193/203
4	Left Front Fender	180.0	182	188	170
5	Left Front Door	163.3	156	169	165
6	Center Panel Left				
7	Left Rear Door	199.3	208	197	193
8	Left Back Panel	490.3	379	372	720
9	Right Front Fender	245.6	210	244	283
10	Right Front Door	209.6	225	194	210
11	Center Panel Right				
12	Right Rear Door	212.0	206	204	226
13	Right Back Panel	249.6	208	259	282

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium / Knobs - Worn, Peel, Crack - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Color Change - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Roof - Repair mark - Difference in Color / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium
Frame Evaluation : D	Functional Evaluation : B
Remarks Right Front Pillar - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Rear LTO plate not original, no warranty booklet, incomplete tools, with jack, with warning device, no spare key, with spare tire, blurred reverse camera, no wiper, repainted, towed unit, ORCR with double registration.