

General Information

Date & Time: 13, May, 2026 14:50

Make	Mitsubishi	Model	L300
YOM	2024	Odo Meter Reading	76,169
Registration No.	FAQ3736	Chassis No.	PAEL65MYRPB010002
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	Commercial Vehicles
Colour	White		

Body / Panel Condition



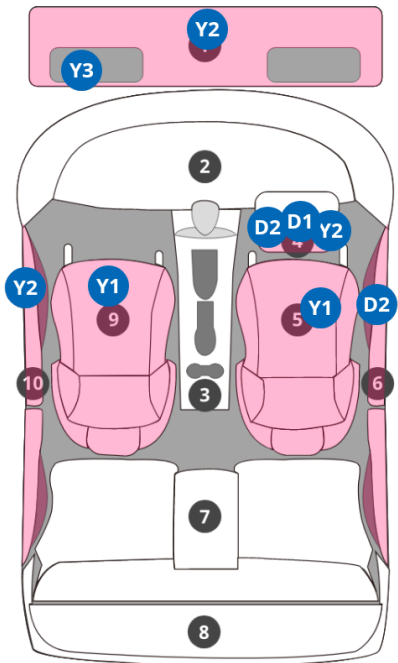
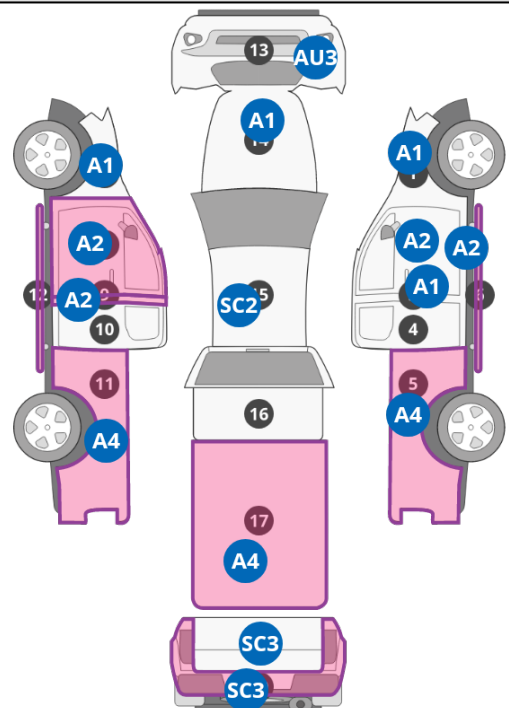
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.3	82	84	75
2	Boot Lid	92.3	93	82	103
3	Roof	72.1	72	71	72/73
4	Left Front Fender	80.2	80	76	85
5	Left Front Door	72.5	73	71	74
6	Center Panel Left	83.5	85	84	82
7	Left Rear Door				
8	Left Back Panel	98.4	88	106	101
9	Right Front Fender	79.8	80	79	80
10	Right Front Door	69.7	75	64	70
11	Center Panel Right	89.9	94	92	84
12	Right Rear Door				
13	Right Back Panel	124.3	130	129	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Loose, Deformed - Small / (R) Front Floor Mat - Grime - Small / Carpet - Worked - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Sunvisor, Sunglass Holder - Grime - Medium / Ceiling - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal	Remarks Cargo Bed Floor - Scratch - Large / Rear Bumper, Lamps, Panels - Rust, Corrosion - Medium / (R) Side Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / Cargo Bed Floor - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch - Large / Rear Gate - Rust, Corrosion - Medium / (L) Side Gate - Scratch - Large / (L) Center Panel - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Center Panel - Scratch - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Minimal / Roof - Rust, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/cargo cab headlining issue/rear room light issue/right cargo cab window issue/scratches on windows/hairline scratches on the body