

General Information

Date & Time: 11, May, 2026 12:32

Make	Mitsubishi	Model	L300
YOM	2025	Odo Meter Reading	18,143
Registration No.	EAL2556	Chassis No.	PAEL65YSSB003786
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	White		

Body / Panel Condition



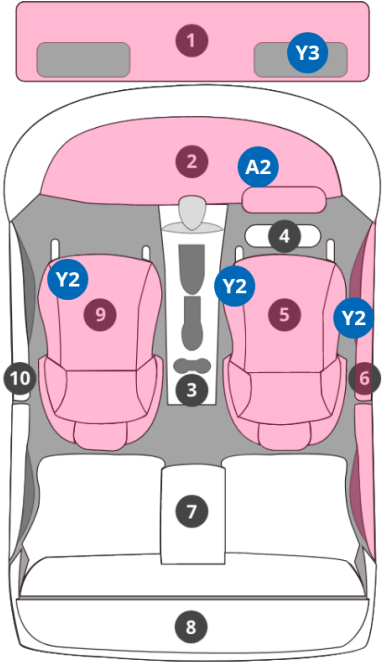
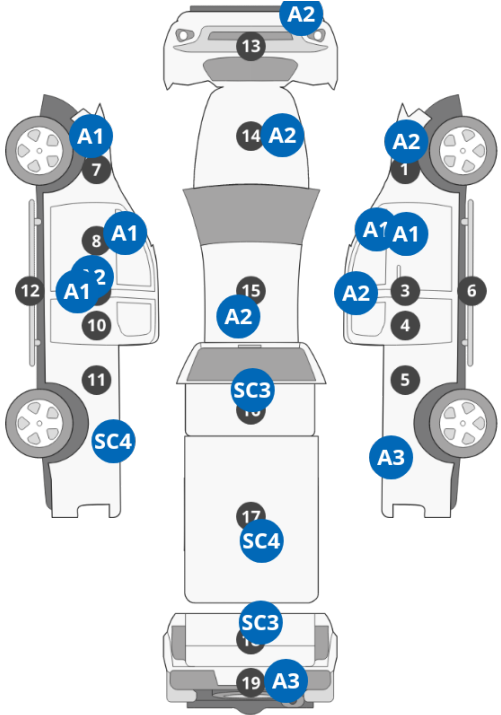
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	78.2	77	83	75
2	Boot Lid	149.6	153	140	156
3	Roof	68.7	70	78	63/65
4	Left Front Fender	74.8	72	81	72
5	Left Front Door	69.2	72	69	67
6	Center Panel Left	72.2	71	71	74
7	Left Rear Door				
8	Left Back Panel	164.3	145	167	181
9	Right Front Fender	85.1	95	76	84
10	Right Front Door	64.8	70	61	64
11	Center Panel Right	82.7	84	84	80
12	Right Rear Door				
13	Right Back Panel	173.6	170	162	189

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Small / (R) Side Gate - Scratch - Medium / Rear Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Rust, Corrosion - Large / Cargo Bed Floor - Rust, Corrosion - Large / Cab Back Panel - Rust, Corrosion - Medium / (L) Front Door, Molding - Scratch - Small / (L) Center Panel - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on headlight