

General Information

Date & Time: 29, Jun, 2026 11:25

Make	Ford	Model	EcoSport
YOM	2016	Odo Meter Reading	1
Registration No.	FAA2469	Chassis No.	MPBSXXMXKSGC45553
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Brown		

Body / Panel Condition



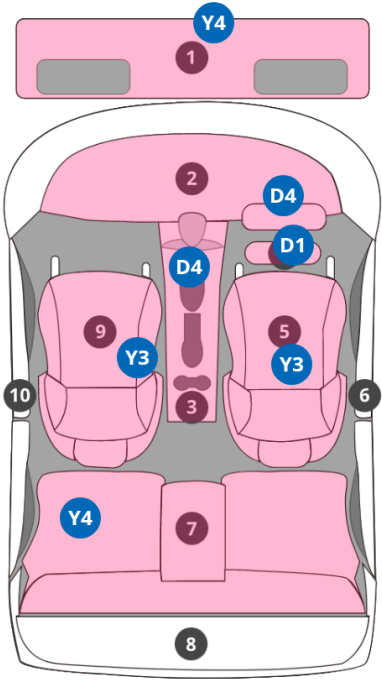
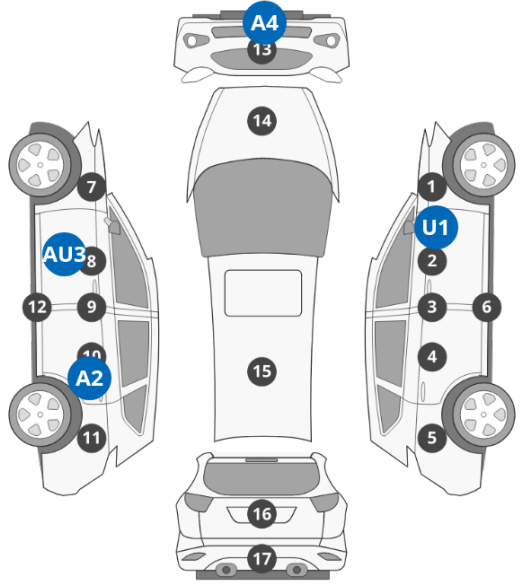
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.0	98	98	96
2	Boot Lid	215.0	199	244	202
3	Roof	93.7	82	92	97/104
4	Left Front Fender	167.0	186	186	129
5	Left Front Door	101.3	97	113	94
6	Center Panel Left				
7	Left Rear Door	94.9	103	102	80
8	Left Back Panel	119.0	115	115	127
9	Right Front Fender	105.7	116	108	93
10	Right Front Door	94.7	92	97	95
11	Center Panel Right				
12	Right Rear Door	88.3	80	90	95
13	Right Back Panel	130.0	156	132	102

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Glove Box - Loose, Deformed - Large / Console, Switchs, Vents - Loose, Deformed - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Carpet - Worked - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with lto plate, no warranty booklet, with spare tire, no jack, no tools, with hairline scratch in the body, can not check functionality weak battery towed unit.