

General Information

Date & Time: 22, May, 2026 16:13

Make	Nissan	Model	Navara
YOM	2018	Odo Meter Reading	98,033
Registration No.	GAJ1772	Chassis No.	MNTCC4D23Z0040004
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



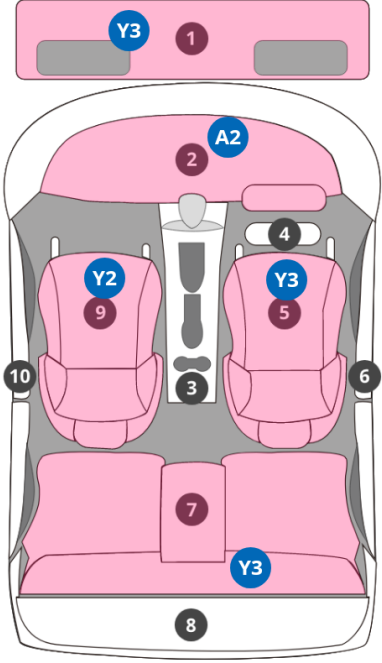
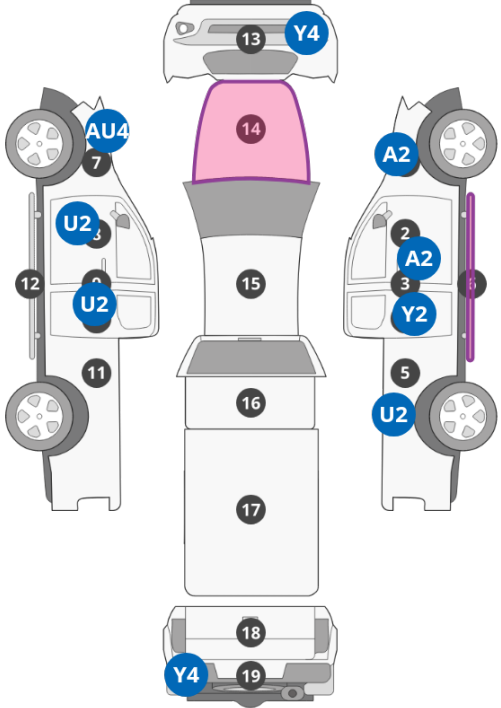
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	339.0	397	190	430
2	Boot Lid	172.6	181	168	169
3	Roof	424.2	1,247	168	138/144
4	Left Front Fender	152.0	157	155	144
5	Left Front Door	146.3	140	139	160
6	Center Panel Left				
7	Left Rear Door	145.6	154	155	128
8	Left Back Panel	136.6	135	131	144
9	Right Front Fender	157.3	146	174	152
10	Right Front Door	144.3	152	148	133
11	Center Panel Right				
12	Right Rear Door	402.0	210	817	179
13	Right Back Panel	176.0	188	170	170

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Medium / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / (R) Rear Door, Molding - Crack, Gap - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Side Gate - Dent - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes
Frame Evaluation : D	Functional Evaluation : E
Remarks Right Center Pillar - Condition of Welding ? - Yes	Remarks Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Hood latch damage. hood repainted. tailgate defective. no horn. blow by on dip stick. 4 wheel drive error. accelerator not functioning. defective AC. no spare tire. No jack and tools. no seat cover. no spare key. no warranty booklet