

General Information

Date & Time: 14, May, 2026 18:32

Make	Toyota	Model	Fortuner
YOM	2025	Odo Meter Reading	11,783
Registration No.	NKN7978	Chassis No.	MHFCB3GS1S0498250
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	White		

Body / Panel Condition



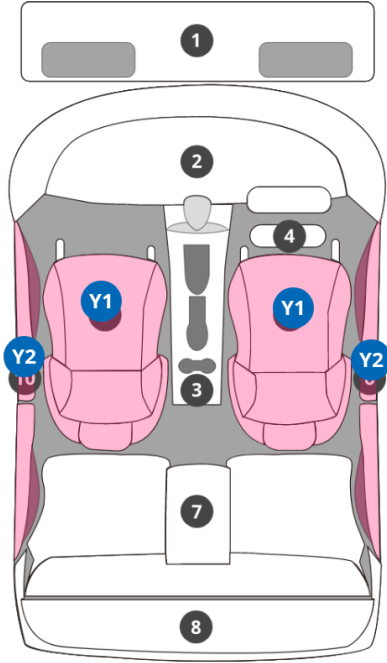
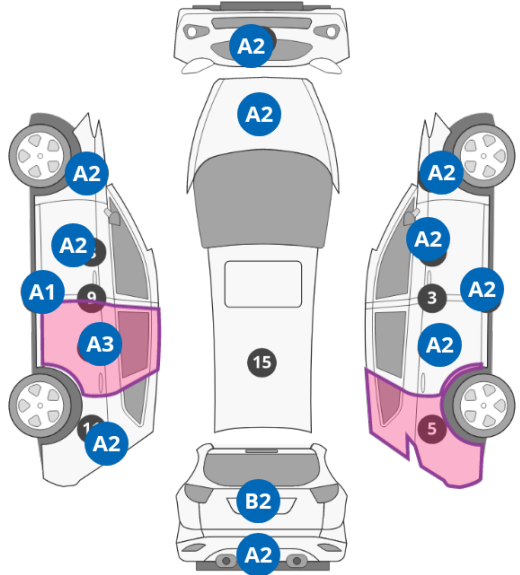
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	382.0	385	416	345
2	Boot Lid	234.6	240	234	230
3	Roof	319.7	318	391	290/280
4	Left Front Fender	330.6	324	298	370
5	Left Front Door	331.6	310	324	361
6	Center Panel Left				
7	Left Rear Door	337.3	338	335	339
8	Left Back Panel	320.3	400	281	280
9	Right Front Fender	318.3	326	328	301
10	Right Front Door	310.3	294	323	314
11	Center Panel Right				
12	Right Rear Door	332.3	335	331	331
13	Right Back Panel	356.6	310	350	410

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Partially Missing - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Modified - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes	Remarks Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
No LTO plate, with warranty booklet, no tools, with jack, no spare key, with spare tire, with seat cover, air-condition leak, repainted, HPG Recovered.