

General Information

Date & Time: 22, May, 2026 07:50

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	13,810
Registration No.	DBN5090	Chassis No.	PA2JA8EM4P0130059
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	MPV
Colour	Black		

Body / Panel Condition



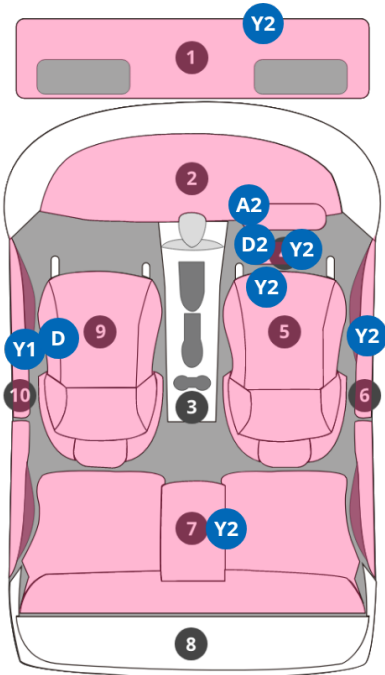
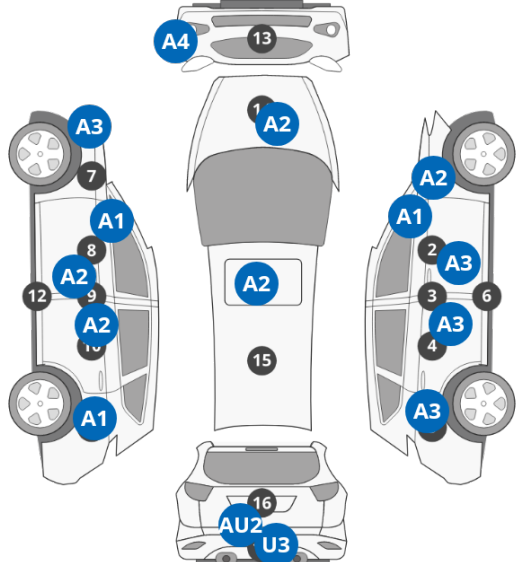
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.4	130	126	96
2	Boot Lid	111.0	113	115	105
3	Roof	105.1	109	109	100/103
4	Left Front Fender	113.6	123	109	109
5	Left Front Door	115.3	131	105	110
6	Center Panel Left				
7	Left Rear Door	116.3	112	128	109
8	Left Back Panel	115.6	108	118	121
9	Right Front Fender	224.3	169	196	308
10	Right Front Door	106.0	110	106	102
11	Center Panel Right				
12	Right Rear Door	108.6	102	106	118
13	Right Back Panel	108.6	104	100	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / Rear Seat - Grime - Small / Glove Box - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no warranty, with jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight