

General Information

Date & Time: 23, May, 2026 08:17

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	28,137
Registration No.	NEC1489	Chassis No.	PA1B18F36S4287768
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



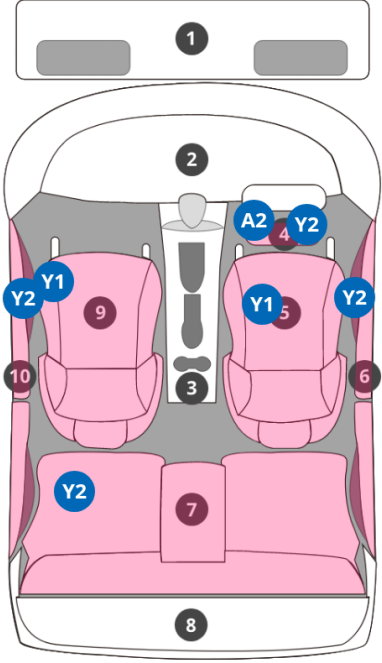
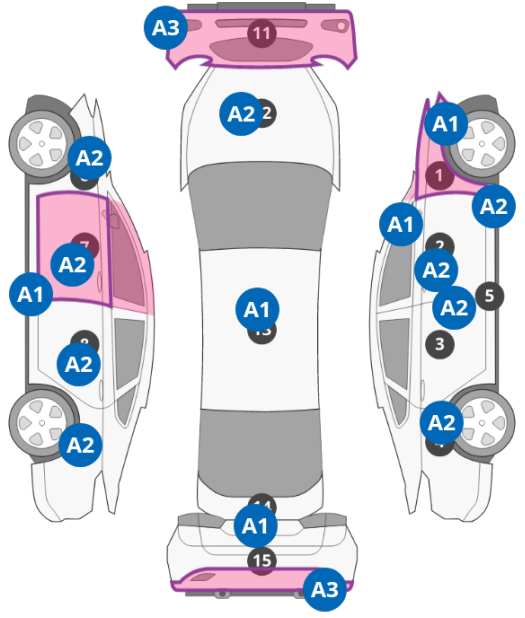
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	108	120	112
2	Boot Lid	105.6	100	105	112
3	Roof	104.3	104	97	112/105
4	Left Front Fender	104.0	105	100	107
5	Left Front Door	102.6	105	102	101
6	Center Panel Left				
7	Left Rear Door	109.0	116	113	98
8	Left Back Panel	111.0	115	106	112
9	Right Front Fender	198.3	169	153	273
10	Right Front Door	162.0	157	162	167
11	Center Panel Right				
12	Right Rear Door	113.3	104	114	122
13	Right Back Panel	113.0	114	112	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body/front bumper emblem missing