

## General Information

Date & Time: 23, May, 2026 08:21

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Hilux Tamaraw     |
| YOM              | 2026    | Odo Meter Reading | 11,624            |
| Registration No. | NEK9286 | Chassis No.       | PAHACACA9S6431366 |
| CC               | 2.4     | Transmission      | M/T               |
| Fuel Type        | Diesel  | Type of Body      | Utility Passenger |
| Colour           | White   |                   |                   |

## Body / Panel Condition



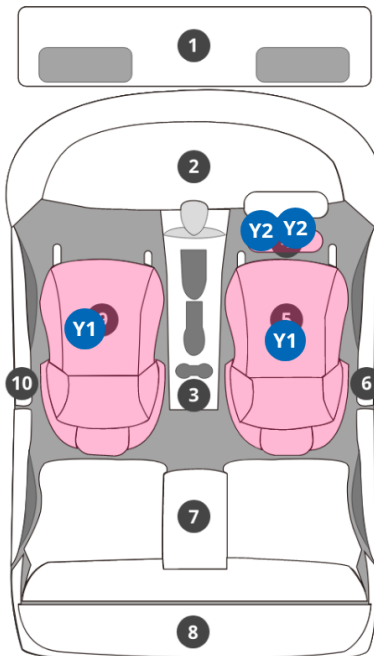
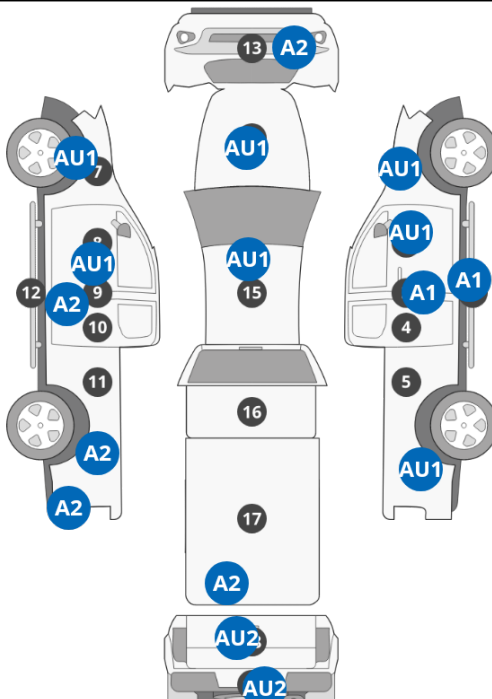
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 122.0         | 107    | 109    | 150      |
| 2  | Boot Lid           | 63.3          | 67     | 61     | 62       |
| 3  | Roof               | 132.7         | 148    | 126    | 136/121  |
| 4  | Left Front Fender  | 112.6         | 113    | 114    | 111      |
| 5  | Left Front Door    | 117.0         | 113    | 117    | 121      |
| 6  | Center Panel Left  | 105.1         | 94     | 93     | 129      |
| 7  | Left Rear Door     | 68.6          | 68     | 52     | 86       |
| 8  | Left Back Panel    | 78.6          | 65     | 112    | 59       |
| 9  | Right Front Fender | 116.6         | 111    | 110    | 129      |
| 10 | Right Front Door   | 107.3         | 103    | 107    | 112      |
| 11 | Center Panel Right | 96.8          | 90     | 80     | 121      |
| 12 | Right Rear Door    |               |        |        |          |
| 13 | Right Back Panel   | 60.0          | 65     | 60     | 55       |

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <div> <div>Interior Evaluation :</div> <div>A</div> </div>                                                                                                                                                                                                                                        | <div> <div>Exterior Evaluation :</div> <div>C</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <div>  </div> <div> <div>a : Cut, Fray</div> <div>d : Loose, Deformed</div> <div>k : Animal Hair</div> <div>s : Smell</div> <div>t : Cigarette Burns</div> <div>x : Defective</div> <div>y : Stain</div> </div> | <div>  </div> <div> <div>A : Scratch</div> <div>AU : Scratch &amp; Dent</div> <div>B : Modified</div> <div>C : Corrosion</div> <div>G : Stone chip</div> <div>P : Faded</div> <div>S : Rust</div> <div>SC : Rust &amp; Corrosion</div> <div>U : Dent</div> <div>X : Defective</div> <div>Y : Crack, Gap</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <div> <div>Remarks</div> <div>(L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small</div> </div>                                                                                                        | <div> <div>Remarks</div> <div>(R) Side Gate - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Center Panel - Scratch - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Guard Frame - Scratch - Small / Cargo Bed Floor - Scratch - Small / Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch &amp; Dent - Minimal</div> </div> |
| <div> <div>Frame Evaluation :</div> <div>A</div> </div>                                                                                                                                                                                                                                           | <div> <div>Functional Evaluation :</div> <div>A</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <div> <div>Remarks</div> <div>Defects not found</div> </div>                                                                                                                                                                                                                                      | <div> <div>Remarks</div> <div>Spare Key - Issue - Unexist</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |

## Inspector Notes

with LTO plate, with spare tire, with jack and inc tools, with manual and warranty booklet, scratches on taillight and headlight, minor scratches on exterior, no reverse camera.