

General Information

Date & Time: 23, May, 2026 15:45

Make	Toyota	Model	Innova
YOM	2021	Odo Meter Reading	113,711
Registration No.	DBF4522	Chassis No.	PA2JA8EM1M0097355
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



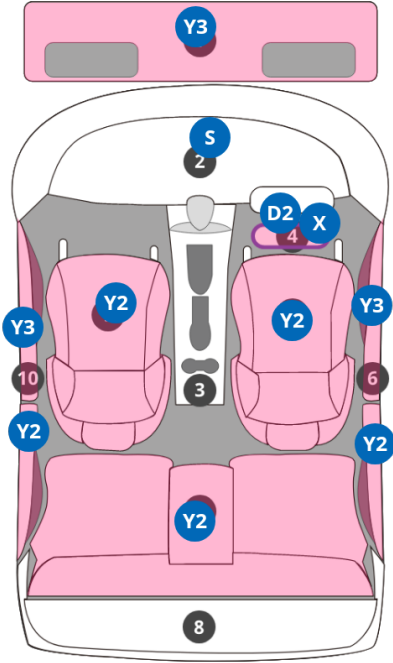
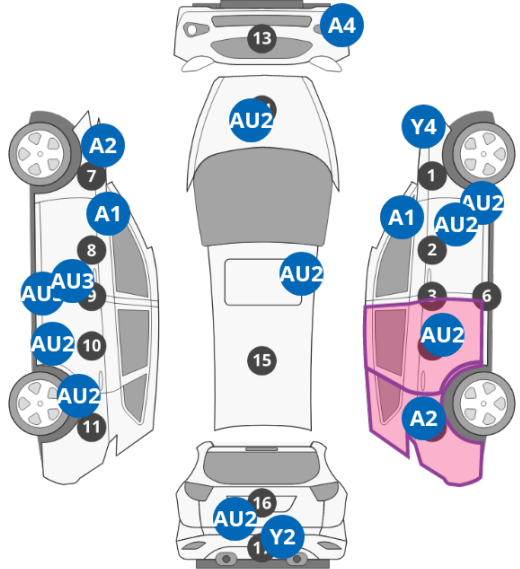
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	112	135	118
2	Boot Lid	107.9	113	98	113
3	Roof	102.2	108	108	92/101
4	Left Front Fender	104.6	100	105	109
5	Left Front Door	105.0	106	105	104
6	Center Panel Left				
7	Left Rear Door	107.6	115	102	106
8	Left Back Panel	119.0	132	116	109
9	Right Front Fender	104.6	100	104	110
10	Right Front Door	105.3	104	112	100
11	Center Panel Right				
12	Right Rear Door	446.3	713	367	259
13	Right Back Panel	279.0	348	320	169

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Medium / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / Overall Exterior - Worn as per age - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/aircon issue/fog light issue/tailight cover cracked/scratches on headlight cover/hairline scratches on the body/no reverse camera/with seat cover