

General Information

Date & Time: 23, May, 2026 19:52

Make	Toyota	Model	Rush
YOM	2020	Odo Meter Reading	60,419
Registration No.	KAD8192	Chassis No.	MHKE8FF2PKK005248
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



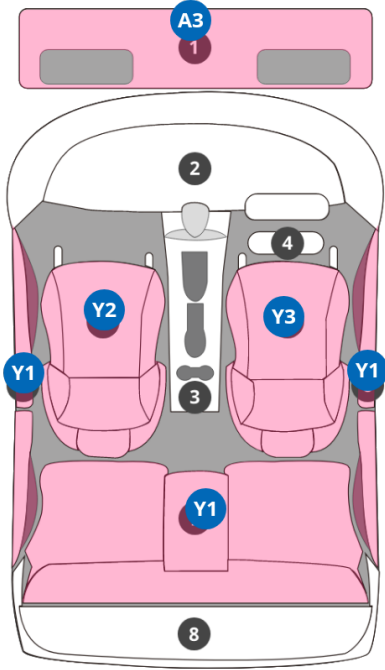
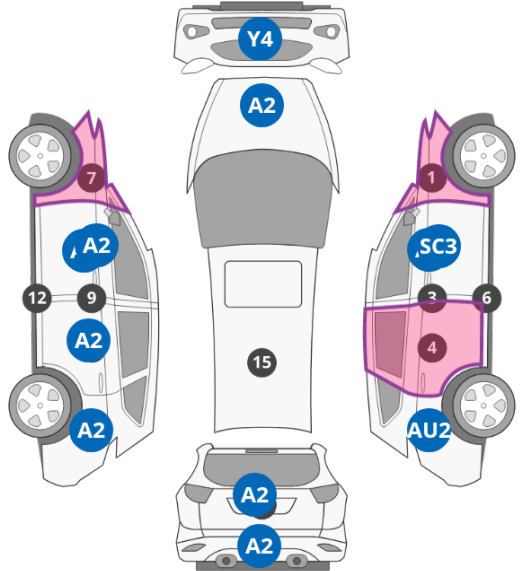
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	161.3	148	187	149
2	Boot Lid	101.6	105	100	100
3	Roof	98.3	85	91	103/115
4	Left Front Fender	173.3	195	166	159
5	Left Front Door	102.6	106	105	97
6	Center Panel Left				
7	Left Rear Door	101.3	104	100	100
8	Left Back Panel	108.7	98	104	124
9	Right Front Fender	986.0	904	785	1,269
10	Right Front Door	153.0	132	159	168
11	Center Panel Right				
12	Right Rear Door	209.0	214	226	187
13	Right Back Panel	105.4	113	99	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Cut, Crack - Medium / Rear Seat - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Rust, Corrosion - Medium / (R) Front Fender, Molding - Partially Missing - Yes / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Partially Missing - Yes / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, no warranty booklet, no spare key, no spare tire, no seat cover, incomplete tools, with jack, left rear window not functioning, with hairline scratches, damaged bumper.